

2026

PRODUCT APPLICATIONS



ADAPT SOLUTIONS

28/09/2026

2026 PRODUCT APPLICATIONS

[CLICK HERE FOR ADAPT SOLUTIONS PRODUCT OVERVIEW VIDEO](#)

SEARCH BY PRODUCT: Click on the **PICTURE** for the overview page. Click on the **VEHICLE LIST** for the 'Quick Reference' page. Once you find the vehicle application you are looking for, click on it to reach the detailed application information.



VEHICLE LIST



VEHICLE LIST



VEHICLE LIST



SEARCH BY MAKE / MODEL: Click on a **BRAND** to reach a list of vehicle models. Click on the **PRODUCT NAME** to reach the detailed application information. *Click on BACK at the bottom of any page to return here.*

Need Assistance? [CHAT WITH US](#)



Volkswagen



CHRYSLER APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Caravan / Town & Country- Stow 'N Go	2005 - 2007		✓* (driver only)	✓
Caravan / Town & Country - Without Stow 'N Go	2005 - 2007		✓ WITH HI-LIFT	✓
Caravan / Town & Country - Short wheelbase	2001 - 2007		✓ WITH HI-LIFT	
Caravan / Town & Country - Long wheelbase	2001 - 2007		✓ WITH HI-LIFT	
Caravan / Town & Country - Swivel 'N Go	2008 - 2011		✓ WITH HI-LIFT	
Caravan / Town & Country - Stow 'N Go	2005 - 2020		✓ WITH HI-LIFT	✓
Caravan / Town & Country	2008 - 2020	✓ DRIVER*/PASSENGER ✓ 2 nd ROW	✓ WITH HI-LIFT	✓
Grand Caravan	2021 - 2027	✓ DRIVER/PASSENGER ✓ 2 nd ROW	✓ ASENTO	✓*
Pacifica	2017 - 2027	✓ DRIVER/PASSENGER ✓ 2 nd ROW	✓ ASENTO	✓
Voyager	2020 - 2027	✓ DRIVER/PASSENGER ✓ 2 nd ROW	✓ ASENTO	✓*
Journey	2008 - 2020	✓* PASSENGER		
Ram Reg Cab - 2 door	2002 - 2008		✓	
Ram Quad Cab - 4 door	2002 - 2008		✓	
Ram Mega Cab - 4 large doors	2006 - 2008		✓	
Ram Quad Cab / Crew Cab CLASSIC- 4 door	2009 - 2018	✓ PASSENGER	✓	
Ram 2500/3500 Crew Cab/Mega Cab- 4 door	2010 - 2018	✓ PASSENGER	✓	
Ram 2500/3500 Crew Cab - 4 door	2019 - 2027	✓ PASSENGER		
Ram 1500 Quad Cab - 4 door	2019 - 2027	✓ DRIVER*/PASSENGER	✓ ASENTO	
Ram 1500 Crew Cab - 4 door	2019 - 2027	✓ DRIVER*/PASSENGER	✓ ASENTO	
Jeep Gladiator	2020 - 2027	✓ DRIVER / PASSENGER		
Jeep Grand Cherokee	2011 - 2022	✓* PASSENGER		
Jeep Wrangler - 4 door	2007 - 2018		✓*	
Jeep Wrangler - 4 door	2018 - 2027	✓* DRIVER / PASSENGER		

*Caravan 2008-2020 - LINK: Steering column **must be telescopic**

*Voyager 2020-2026 - **SPEEDY-LIFT: NOT AVAILABLE** PASSENGER side model with bench seat & **NOT AVAILABLE** 8 passengers LXi model

*Grand Caravan 2021-2026 - **SPEEDY-LIFT: NOT AVAILABLE** PASSENGER side model with bench seat & **NOT AVAILABLE** 8 passengers LXi model

*Jeep Grand Cherokee 2011-2022 **NOT AVAILABLE** for model with **MANUAL SEATS & NOT AVAILABLE** for **WL Platform**

*Jeep Wrangler - **4 door** 2018-2026 - **LINK: NOT AVAILABLE** for **JK model (2018)**

*Jeep Wrangler - **4 door** 2007-2018 - **XL-SEAT: NOT AVAILABLE** for **JL model (2018)**

*Journey 2008-2020 - **LINK: ONLY AVAILABLE** for model with **SEAT STORAGE**

*Ram 1500 Crew/Quad 2019-2026: **NOT AVAILABLE** for RAM CLASSIC - **2018 model**

*Ram 1500 Crew/Quad 2019-2026: **NOT AVAILABLE** for RAM TUNGSTEN Trim Level - **2025 model**



FORD APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Mark LT - 4 door	2006 - 2008		✓	
F-150 Reg Cab - 2 door	2004 - 2008		✓	
F-150 Reg Cab - 2 door (small suicide door)	2009 - 2010		✓	
F-150 Super Cab - Suicide door	2004 - 2008		✓	
F-150 Super Crew Cab - 4 door	2004 - 2008		✓	
F-150 Super Cab - Suicide door	2009 - 2014	✓ DRIVER / PASSENGER	✓*	
F-150 Super Crew Cab - 4 door	2009 - 2014	✓ DRIVER / PASSENGER	✓	
F-150 Super Cab - Suicide door	2015 - 2020	✓ DRIVER / PASSENGER	✓*	
F-150 Super Crew Cab - 4 door	2015 - 2020	✓ DRIVER / PASSENGER	✓	
F-150 Super Cab - Suicide door	2021 - 2027	✓ DRIVER / PASSENGER		
F-150 Super Crew Cab - 4 door	2021 - 2027	✓ DRIVER / PASSENGER	✓	
F-150 Raptor Super Cab - Suicide door	2011 - 2016	✓* DRIVER / PASSENGER	✓*	
F-150 Raptor Super Crew Cab - 4 door	2011 - 2016	✓* DRIVER / PASSENGER	✓	
F-150 Raptor Super Cab - Suicide door	2017 - 2027	✓ DRIVER / PASSENGER	✓*	
F-150 Raptor Super Crew Cab - 4 door	2017 - 2027	✓ DRIVER / PASSENGER	✓	
F-250, F-350, F-450 Super Cab - Suicide door	2008 - 2010		✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2008 - 2010		✓	
F-250, F-350, F-450 Super Cab - Suicide door	2011 - 2016	✓ DRIVER / PASSENGER	✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2011 - 2016	✓ DRIVER / PASSENGER	✓	
F-250, F-350, F-450 Super Cab - Suicide door	2017 - 2027	✓ DRIVER / PASSENGER	✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2017 - 2027	✓ DRIVER / PASSENGER	✓	
Ranger Super Crew Cab - 4 door	2019 - 2023	✓* PASSENGER	✓ ASENTO	
Ranger Super Crew Cab - 4 door	2024 - 2027	✓ PASSENGER	✓ ASENTO	

* Ford F-150 Super Cab - Suicide door **ASENTO: NOT AVAILABLE** for model with **ONLY 2 DOORS**

* Ford F-150 Raptor Super Cab - Suicide door **ASENTO: NOT AVAILABLE** for model with **ONLY 2 DOORS**

* Raptor Super Cab - Suicide door / 4 door 2011 only - **NOT AVAILABLE** for model with **4 load cells**

* Ranger Super Crew Cab - **NOT AVAILABLE** for models with **POWER SEAT**



FORD APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Explorer	2011 - 2015	✓ PASSENGER	✓	
Explorer	2016 - 2019	✓ PASSENGER	✓	
Explorer	2020 - 2027	*✓ DRIVER / PASSENGER	*✓	
Escape	2013 - 2019	✓ PASSENGER		
Escape	2020 - 2026	✓ PASSENGER		
Expedition / Navigator	2007 - 2017	✓ PASSENGER		
Expedition / Navigator	2018 - 2024	*✓ DRIVER/PASSENGER *✓ 2 nd ROW	✓* ASENTO	
Expedition / Navigator	2025 - 2027	*✓ DRIVER/PASSENGER *✓ 2 nd ROW	✓* ASENTO	
Edge	2011 - 2014		✓	
Edge	2015 - 2024	✓ PASSENGER	✓ ASENTO	
Lincoln MKX	2016 - 2018	✓ PASSENGER	✓ ASENTO	
Lincoln Nautilus	2019 - 2023	✓ PASSENGER	✓ ASENTO	
Transit Connect	2010 - 2013		✓	✓

*2018-2024 Ford Expedition FRONT- **LINK: NOT AVAILABLE** for model with **MANUAL SEAT**

*2018-2024 Lincoln Navigator FRONT- **LINK: NOT AVAILABLE** for model with **PERFECT POSITION SEAT**

*2018-2024 Ford Expedition & Lincoln Navigator 2ND ROW - **LINK: ONLY AVAILABLE** for **LONG WHEELBASE** model (Navigator L & Expedition MAX)

*2018-2024 Ford Expedition - **ASENTO: NOT AVAILABLE** for model with **PERFECT POSITION SEAT** or model with **MANUAL SEAT**

*2020-2026 Ford Explorer - **ASENTO & LINK: NOT AVAILABLE** for model with **MANUAL SEAT**



GENERAL MOTORS APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Avalanche	2007 - 2013	✓ DRIVER / PASSENGER	✓	
Canyon / Colorado Extended Cab - Suicide door	2004 - 2012		✓	
Canyon / Colorado Extended Cab- Suicide door	2015 - 2022	✓ DRIVER* / PASSENGER*	✓ ASENTO	
Canyon / Colorado Crew Cab- 4 door	2015 - 2022	✓ DRIVER* / PASSENGER	✓ ASENTO	
Canyon / Colorado Crew Cab- 4 door	2023 - 2027	✓ DRIVER / PASSENGER	✓ ASENTO	
Sierra / Silverado Regular Cab-1500- 2 door	1999 - 2013		✓	
Sierra / Silverado Extended Cab-1500- No suicide door	1999 - 2002		✓	
Sierra / Silverado Extended Cab-1500- Suicide door	2001 - 2006		✓	
Sierra / Silverado Extended Cab-1500- Suicide door	2007 - 2013	✓ DRIVER / PASSENGER	✓	
Sierra / Silverado Double Cab-1500- 4 door (2 smaller)	2014 - 2018	✓ DRIVER / PASSENGER	✓ ASENTO	
Sierra / Silverado Crew Cab-1500- 4 door	2007 - 2013	✓ DRIVER / PASSENGER	✓	
Sierra / Silverado Crew Cab-1500- 4 door	2014 - 2018	✓ DRIVER / PASSENGER	✓ ASENTO	
Sierra / Silverado Crew Cab-1500- 4 door	2019 - 2026	✓* DRIVER / PASSENGER	✓* ASENTO	
Sierra / Silverado Double Cab-1500- 4 door (2 smaller)	2019 - 2026	✓* DRIVER / PASSENGER	✓* ASENTO	
Sierra / Silverado HD-2500 / 3500- All models	2007 - 2014	✓ DRIVER / PASSENGER	✓	
Sierra / Silverado HD-2500 / 3500- All models	2015 - 2027	✓ DRIVER / PASSENGER	✓* ASENTO	
Escalade / Suburban / Tahoe / Yukon - All models	2007 - 2014	✓ DRIVER / PASSENGER	✓	
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	✓ DRIVER / PASSENGER	✓ ASENTO	
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2027	✓ DRIVER / PASSENGER	✓ ASENTO	
Blazer	2019 - 2026	✓ DRIVER / PASSENGER*	✓* ASENTO	

*2015–2022 Canyon / Colorado Extended Cab - **LINK**: Rear door must be opened for operation

*2015–2022 Canyon / Colorado Crew Cab - **LINK**: Steering column must be telescopic

*2019–2026 Blazer - **ASENTO & LINK**: **NOT AVAILABLE** for **EV / ELECTRIC VEHICLE**

*2019–2026 Sierra / Silverado – **LINK & ASENTO**: **NOT AVAILABLE** for **EV / ELECTRIC VEHICLE**

*2015–2026 Sierra / Silverado HD-2500 / 3500- All models – **LINK & ASENTO**: **NOT AVAILABLE** for **EV / ELECTRIC VEHICLE**



GENERAL MOTORS APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Acadia <i>(See note on Limited)</i>	2008 - 2016	✓* PASSENGER		
Acadia	2017 - 2023	✓ DRIVER / PASSENGER	✓ ASENTO	
Acadia	2024 - 2027	✓ PASSENGER		
Cadillac XT6	2020 - 2025	✓ DRIVER / PASSENGER		
Enclave	2008 - 2017	✓ PASSENGER		
Enclave	2018 - 2024	✓* DRIVER / PASSENGER & 2 nd ROW	✓ ASENTO	
Enclave	2025 - 2027	✓ PASSENGER		
Terrain / Equinox	2010 - 2017	✓ PASSENGER		
Terrain / Equinox	2018 - 2024	✓ DRIVER / PASSENGER	✓ ASENTO	
Terrain / Equinox	2025 - 2027	✓* PASSENGER	✓ ASENTO	
Traverse	2008 - 2017	✓ PASSENGER		
Traverse	2018 - 2023	✓* DRIVER / PASSENGER & 2 nd ROW	✓ ASENTO	
Traverse	2024 - 2027	✓ PASSENGER		

*GMC Acadia Limited 2017 is the 2008-2016 body style

*Enclave 2018-2024 - LINK: **NOT AVAILABLE** in driver position for model with manual seat. | 2nd Row, **NOT AVAILABLE** for 8 passenger model

*Traverse 2018-2023 - LINK: **NOT AVAILABLE** in driver position for model with manual seat. | 2nd Row, **NOT AVAILABLE** for 8 passenger model

*Terrain / Equinox 2025-2026 - LINK: **NOT AVAILABLE** EV / ELECTRIC VEHICLE



HONDA APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Odyssey	2005 - 2010		✓ WITH HI-LIFT	✓
Odyssey	2011 - 2017		✓	✓
Odyssey	2018 - 2027	✓ 2 nd ROW	✓ ASENTO	✓



HYUNDAI APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Palisade	2020 - 2025	✓ DRIVER*/PASSENGER*	✓*	

*Palisade 2020-2025 - LINK & ASENTO: **NOT AVAILABLE** for models with **MANUAL SEATS**



KIA APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Carnival	2022 - 2027	✓ DRIVER* / PASSENGER & 2 nd ROW	✓*	✓
Sedona	2006 - 2012	✓ 2 nd ROW		
Sedona	2012 - 2014	✓ 2 nd ROW		
Sedona	2015 - 2021	✓ PASSENGER & 2 nd ROW*	✓	✓*
Telluride	2020 - 2025	✓ DRIVER* / PASSENGER*	✓*	
Ev9	2023 - 2027	✓ DRIVER* / PASSENGER*	✓	

*Sedona 2015-2021 - **NOT AVAILABLE** for models with **OEM footrest** | *Discontinued in Canada 2019-2020 model*

*Carnival 2022-2026 - **LINK: NOT AVAILABLE** in driver position for model with manual seat

*Carnival 2022-2026 - **ASENTO: NOT AVAILABLE** for model with manual seat

*Telluride 2020-2025 - **ASENTO: NOT AVAILABLE** for model with manual seat

*Telluride 2020-2025 - **LINK: NOT AVAILABLE** for model with manual seat

*EV9 2023-2026 - **LINK: NOT AVAILABLE** for Relaxation comfort seat (leg rest)



MAZDA APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Mazda 5 *	2006 - 2015			✓

*Discontinued in USA in 2015, discontinued in Canada in 2017



Mercedes-Benz

MERCEDES APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Metris	2016 - 2023		✓ ASENTO	✓



NISSAN APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Ariya	2022 - 2026		✓ ASENTO	



SUBARU APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENTO	SPEEDY LIFT
Forester	2014 - 2018		✓ ASENTO	



TESLA APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
X	2015 - 2020		✓ ASENTO	*✓ SPEEDY
X	2021 - 2026		✓ ASENTO	*✓ SPEEDY

*Tesla X 2015-2026 – **SPEEDY-LIFT: NOT AVAILABLE** PASSENGER side, model with bench seat.

*Tesla X 2021-2026 – **SPEEDY-LIFT: NOT AVAILABLE** for model with bucket seat.



TOYOTA APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Sienna	2004 - 2010		✓ WITH HI-LIFT	✓
Sienna - Power seat	2005 - 2010		✓ WITH HI-LIFT	✓
Sienna- 7 & 8 passenger	2011 - 2020	✓ DRIVER/PASSENGER ✓ 2 nd ROW*	✓ WITH HI-LIFT	✓ *SEE NOTE
Sienna- 7 & 8 passenger	2021 - 2027	✓ DRIVER/PASSENGER ✓ 2 nd ROW*	✓ ASENTO	✓ *SEE NOTE
Tacoma Access Cab - Suicide door	2005 - 2015	✓ PASSENGER	✓	
Tacoma Access Cab - Suicide door	2016 - 2023	✓ PASSENGER	✓ ASENTO	
Tacoma Double Cab - 4 reg. door	2005 - 2023	✓ PASSENGER	✓	
Tacoma Double Cab - 4 reg. door	2024 - 2027	✓* DRIVER/PASSENGER		
Tundra Double Cab - 4 door (rear doors smaller)	2014 - 2021	✓ DRIVER / PASSENGER	✓ ASENTO	
Tundra Crew Max - 4 door	2014 - 2021	✓ DRIVER / PASSENGER	✓ ASENTO	
Tundra Crew Max - 4 door	2022 - 2027	✓ DRIVER / PASSENGER		
4 Runner	2003 - 2024		✓	
Rav 4	2006 - 2012		✓	
Rav 4	2013 - 2018	✓ PASSENGER	✓*	
Rav 4	2019 - 2025	✓* PASSENGER	✓ ASENTO	
Venza	2008 - 2016	✓* PASSENGER		
Highlander	2014 - 2019	✓ PASSENGER	✓ ASENTO	
Highlander	2020 - 2026	✓* PASSENGER		
Grand Highlander	2020 - 2027	✓ PASSENGER		

***SEE MORE NOTES ON NEXT PAGE**

*Highlander 2020-2026- **LINK:** passenger side **NOT AVAILABLE FOR MANUAL SEATS**

*Sienna 2011-2020 (8 passenger) - **LINK:** 2nd row - driver side **NOT AVAILABLE** & passenger side **NOT AVAILABLE** with footrest.

- *Sienna 2021-2026 (8 passenger) - **LINK**: 2nd row - driver side **NOT AVAILABLE** & passenger side **NOT AVAILABLE** with footrest.
- *Sienna 2011-2020 (8 passenger) - **SPEEDY**: Passenger side all mid-row seats will be removed.
- *Sienna 2021-2026 (8 passenger) - **SPEEDY**: Passenger side all mid-row seats will be removed.
- *Rav 4 2019-2025 - **LINK**: **ONLY AVAILABLE** for model with manual seat.
- *Tacoma 2024-2026- **LINK**: **NOT AVAILABLE** for model with manual seat.
- *Venza 2008-2016 - **LINK**: passenger side **ONLY AVAILABLE** for model with manual seat.



Volkswagen

VOLKSWAGEN APPLICATIONS

MODEL	YEAR	LINK 2.0	XL-SEAT ASENT0	SPEEDY LIFT
Routan	2009 - 2012	✓ DRIVER/PASSENGER ✓ 2 nd ROW	✓ WITH HI-LIFT	✓
Atlas	2018 - 2026	✓* DRIVER/PASSENGER	✓	
ID Buzz	2025 - 2027	✓	✓	✓

- *Atlas 2018-2026 - **LINK**: Front passenger **NOT AVAILABLE** for model with manual seat.

LINK 2.0



WEBSITE RESOURCES

Connect to the locked portion of the site.



HOW IT WORKS VIDEO

In just a few minutes, see all of the key features of the product.



WHAT IS LINK 2.0

Overview of the LINK 2.0 features.



HIGHLIGHTS

- Only uses OEM seat
- All safety features retained
- Great comfort, legroom and space
- Seating behind LINK is not affected
- Customizable movements
- Compatible with 100's of vehicles
- 3 year warranty, 350 lbs capacity



THINGS TO REMEMBER


- The LINK uses the original seat; however, due to the many trim levels available for a given application, it is possible that some of the vehicle's original features will need to be cancelled or removed at the time of installation.
- Note that during the install, OEM wire harness is cut and extended under the seat to maintain the OEM security and comfort features. Installation also involves trim and/or shroud modification based on vehicle year, make and model.

LINK 2.0 | REFERENCES



USER DELIVERY VIDEO

Learn how the pendant and seat adjustments work.

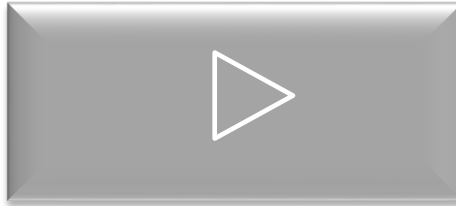

REDUCED POWER MODE

If the vehicle battery dies or gets disconnected, the LINK protects itself with a reduced power mode.



AUTO-DIAGNOSTIC

The LINK is equipped with an auto-diagnostic system that can be run over the phone with a technician.



Throughout this tool you will find references to assist you in evaluating the feasibility of a LINK in specific vehicles to meet your client's specific needs. In some applications, the seated position and/or the forward and aft travel of the seat changes with the LINK installed. Below is a visual aid to explain how these details are to be understood.

(OEM = Original Equipment Manufacturer. | Chrysler; GM, Toyota, etc. | from the factory)



MANUAL BACK UP VIDEO

In the unlikely event of an issue, the LINK is equipped with a manual back up.

SEAT HEIGHT	SEAT ADJUSTMENT	VERTICAL TRAVEL
		
This information will give an idea of the seat height with the LINK installed. Due to the various seat styles offered by vehicle manufacturers, the information is supplied as a reference to assist you in establishing if the seated height on the LINK will be suitable for your client. Example: In the 2015 Ford F-150 Super Cab – the note reads as follows: “Seat height: ½ inch lower than OEM (non-adjustable manual seat)” This means that in that model of Ford, with a manual seat (a seat that doesn’t offer ‘height’ adjustment) the LINK will sit half an inch lower than it did before the installation. (See visual aid – not to scale)	This information is so you can establish the forward and back movements of the seat with the LINK. In all applications, the LINK adds power forward and backward movements, regardless of the seat’s original functions. In some applications, the travel is limited. The seat adjustment information will allow you to confirm if the installation of the LINK will be suitable for your client’s needs. FRONT is to indicate towards the steering wheel or front of the vehicle. BACK is to indicate towards the rear of the vehicle.	This information is so you can establish the estimated transfer height of the LINK in most vehicles. As suspensions, tires and wheels can affect the exact height at which a vehicle sits, this method can allow you to evaluate more accurately the transfer height in your specific vehicle. The LINK has two travel lengths, SHORT: for most minivans, SUV’s and smaller vehicles; and LONG: for trucks and large SUV’s. Please confirm the model in question, SHORT or LONG with our sales or service department. (See visual aid – not to scale)



LINK 2.0 QUICK REFERENCE

page 1 of 4

CHRYSLER		DRIVER	PASSENGER	2 nd ROW
Caravan / Town & Country (*T&C discontinued 2016)	☒ 2008 - 2020	✓*	✓	✓
Grand Caravan	2021 - 2027	✓	✓	✓
Pacifica	2017 - 2027	✓	✓	✓
Voyager	2020 - 2027	✓	✓	✓
Ram 1500 CLASSIC Crew Cab - 4 door	2009 - 2023		✓	
Ram 1500 Crew cab - 4 door	2019 - 2027	✓*	✓*	
Ram 1500 CLASSIC Quad Cab - 4 door	2009 - 2023		✓	
Ram 1500 Quad Cab - 4 door	2019 - 2026	✓*	✓*	
Ram 2500/3500 - 4 door	2010 - 2018		✓	
Ram 2500/3500 - 4 door	2019 - 2027		✓	
Jeep Gladiator	2020 - 2027	✓	✓	
Jeep Grand Cherokee	2011 - 2022		✓*	
Jeep Wrangler - 4 door	2018 - 2027	✓*	✓*	
Journey	☒ 2008 - 2020		✓*	
FORD		DRIVER	PASSENGER	2 nd ROW
F-150 Super Cab - Suicide door	☒ 2009 - 2014	✓	✓*	
F-150 Super Crew Cab - 4 door	☒ 2009 - 2014	✓	✓*	
F-150 Super Cab - Suicide door	2015 - 2020	✓	✓	
F-150 Super Crew Cab - 4 door	2015 - 2020	✓	✓	
F-150 Super Cab - Suicide door	2021 - 2027	✓	✓	
F-150 Super Crew Cab - 4 door	2021 - 2027	✓	✓	
Raptor Super Cab - Suicide door	☒ 2011 - 2016	✓	✓*	
Raptor Super Crew Cab - 4 door	☒ 2011 - 2016	✓	✓*	
Raptor Super Cab - Suicide door	2017 - 2027	✓	✓	
Raptor Super Crew Cab - 4 door	2017 - 2027	✓	✓	
F-250, F-350, F-450 Super Cab - Suicide door	☒ 2011 - 2016	✓	✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	☒ 2011 - 2016	✓	✓	
F-250, F-350, F-450 Super Cab - Suicide door	2017 - 2027	✓	✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2017 - 2027	✓	✓	
Ranger Super Crew Cab - 4 Door	2019 - 2023		✓*	
Ranger Super Crew Cab - 4 Door	2024 - 2027		✓	
Explorer	☒ 2011 - 2015		✓	
Explorer	2016 - 2019		✓	
Explorer	2020 - 2027	✓*	✓*	
Expedition / Navigator	☒ 2007 - 2017		✓	
Expedition / Navigator	2018 - 2024	✓*	✓*	✓*
Expedition / Navigator	2025 - 2027	✓*	✓*	✓*
Escape	☒ 2013 - 2019		✓	
Escape	2020 - 2026		✓	
Edge	2015 - 2024		✓	
Lincoln MKX	☒ 2016 - 2021		✓	
Nautilus	2019 - 2023		✓	
GENERAL MOTORS (Continued on page 2)		DRIVER	PASSENGER	2 nd ROW
Avalanche⚠	☒ 2007 - 2013	✓	✓	
Colorado / Canyon Extended Cab - Suicide door	2015 - 2022	✓*	✓*	
Colorado / Canyon Crew Cab - 4 door	2015 - 2022	✓*	✓	
Colorado / Canyon Crew Cab - 4 door	2023 - 2027	✓	✓	

☒ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

ADAPT SOLUTIONS
BACK
09-2026

LINK 2.0 QUICK REFERENCE

page 2 of 4

GENERAL MOTORS		DRIVER	PASSENGER	2 nd ROW
Sierra / Silverado Extended Cab -1500- Suicide door ▲	☒ 2007 - 2013	✓	✓	
Sierra / Silverado Double Cab -1500- 4 door (2 smaller)	2014 - 2018	✓	✓	
Sierra / Silverado Double Cab -1500- 4 door (2 smaller)	2019 - 2026	✓*	✓*	
Sierra / Silverado Crew Cab -1500- 4 door ▲	☒ 2007 - 2013	✓	✓	
Sierra / Silverado Crew Cab -1500- 4 door	2014 - 2018	✓	✓	
Sierra / Silverado Crew Cab -1500- 4 door	2019 - 2026	✓*	✓*	
Sierra / Silverado HD -2500 / 3500- Ext. & 4 door ▲	☒ 2007 - 2014	✓	✓	
Sierra / Silverado HD -2500 / 3500- 4 door	2015 - 2019	✓	✓	
Sierra / Silverado HD -2500 / 3500- 4 door	2020 - 2027	✓*	✓*	
Escalade / Suburban / Tahoe / Yukon - All models ▲	☒ 2007 - 2014	✓	✓	
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	✓	✓	
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2027	✓	✓	
Acadia	☒ 2008 - 2016		✓	
Acadia	2017 - 2023	✓*	✓	
Acadia	2024 - 2027		✓	
Blazer	2019 - 2026	✓*	✓*	
Cadillac XT6	2020 - 2025	✓	✓	
Enclave	☒ 2008 - 2017		✓	
Enclave	2018 - 2024	✓*	✓	✓*
Enclave	2025 - 2027		✓	
Traverse	☒ 2008 - 2017		✓	
Traverse	2018 - 2023	✓*	✓	✓*
Traverse	2024 - 2027		✓	
Terrain / Equinox	☒ 2010 - 2017		✓	
Terrain / Equinox	2018 - 2024	✓*	✓*	
Terrain / Equinox	2025 - 2027		✓*	
HONDA		DRIVER	PASSENGER	2 nd ROW
Odyssey	2018 - 2027			✓
HYUNDAI		DRIVER	PASSENGER	2 nd ROW
Palisade	2020 - 2025	✓*	✓*	
KIA		DRIVER	PASSENGER	2 nd ROW
Carnival	2022 - 2027	✓*	✓	✓*
EV9	2023 - 2027	✓*	✓*	
Sedona	☒ 2006 - 2014			✓*
Sedona	2015 - 2021		✓	✓*
Telluride	2020 - 2025	✓*	✓*	
TOYOTA		DRIVER	PASSENGER	2 nd ROW
Sienna	☒ 2011 - 2020	✓	✓	✓*
Sienna	2021 - 2027	✓	✓	✓*
Tacoma Access Cab – Suicide door	2005 - 2023		✓	
Tacoma Double Cab – 4 door	2005 - 2023		✓	
Tacoma Double Cab – 4 door	2024 - 2027	✓*	✓*	
Tundra Double Cab – 4 door (2 smaller)	2014 - 2021	✓	✓	
Tundra Crew Max – 4 door	2014 - 2021	✓	✓	
Tundra Crew Max – 4 door	2022 - 2027	✓*	✓*	
Rav 4	☒ 2013 - 2018		✓	
Rav 4	2019 - 2025		✓*	
Venza	☒ 2008 - 2016		✓*	

☒ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

ADAPT SOLUTIONS
BACK
09-2026

LINK 2.0 QUICK REFERENCE

page 3 of 4

TOYOTA		DRIVER	PASSENGER	2 nd ROW
Highlander	⌚ 2014 - 2019		✓	
Highlander	2020 - 2026		✓*	
Grand Highlander	2020 - 2027		✓	
VOLKSWAGEN		DRIVER	PASSENGER	2 nd ROW
Routan	⌚ 2009 - 2012	✓	✓	✓
Atlas	2018 - 2026	✓	✓*	
ID Buzz	2025 - 2027	✓	✓	

LINK 2.0 QUICK REFERENCE

page 4 of 4

Notes to specific applications - marked * on the QUICK REFERENCE		
Caravan / Town & Country	2008 - 2020	* STEERING COLUMN MUST BE TELESCOPIC.
Ram 1500 Quad/ Crew Cab – 4 door	2019 - 2027	* NOT AVAILABLE for CLASSIC body style – 2018 model.
Ram 1500 TUNGSTEN	- 2026	* NOT AVAILABLE for TUNGSTEN TRIM LEVEL.
Jeep Wrangler – 4 door	2018 - 2027	* NOT AVAILABLE for JK model (2018) * ONLY AVAILABLE for manual seat
Jeep Gladiator	2020 - 2027	* ONLY AVAILABLE for manual seat
Jeep Grand Cherokee	2011 - 2022	* NOT AVAILABLE for model with MANUAL SEAT * NOT AVAILABLE for WL Platform
Journey	2008 - 2020	* ONLY AVAILABLE for model with SEAT STORAGE
F-150 Super Cab - Suicide door / 4 door	2011 - only	* NOT AVAILABLE for model with 4 load cells (see <i>pics Install Page</i>)
Explorer	2020 - 2027	* NOT AVAILABLE for model with MANUAL SEAT
Raptor Super Cab - Suicide door / 4 door	2011 - only	* NOT AVAILABLE for model with 4 load cells (see <i>pics Install Page</i>)
Ford Ranger Super Crew	2019 - 2023	* NOT AVAILABLE for model with POWER SEAT
Acadia	2017 - 2023	* NOT AVAILABLE for Driver position 2017 LIMITED trim level
Ford Expedition (Front)	2018 - 2024	* NOT AVAILABLE for model with MANUAL SEAT
Ford Expedition/Navigator (2 nd Row)	2018 - 2024	* ONLY AVAILABLE for Long wheelbase (Exp. MAX & Nav. L)
Ford Expedition (Front)	2025 - 2027	* NOT AVAILABLE for model with MANUAL SEAT
Ford Expedition/Navigator (2 nd Row)	2025 - 2027	* ONLY AVAILABLE for Long wheelbase (Exp. MAX & Nav. L)
Navigator (Front)	2018 - 2024	* NOT AVAILABLE for model with PERFECT POSITION SEAT
Canyon/ Colorado Ext Cab – Suicide door	2015 - 2022	* Rear door MUST BE OPEN for LINK operation
Canyon/ Colorado Crew Cab – 4 door	2015 - 2022	* STEERING COLUMN MUST BE TELESCOPIC
Extended Cab – Suicide door	2015 - 2022	* STEERING COLUMN MUST BE TELESCOPIC
Sierra / Silverado	2019 – 2026	* NOT AVAILABLE for EV / ELECTRIC VEHICLE
Sierra / Silverado HD-2500 / 3500- All models	2015 – 2027	* NOT AVAILABLE for EV / ELECTRIC VEHICLE
Blazer	2019 - 2026	* NOT AVAILABLE for EV / ELECTRIC VEHICLE
Enclave (Driver/Front)	2018 - 2024	* NOT AVAILABLE for Driver position with MANUAL SEAT
Enclave (2 nd ROW)	2018 - 2024	* NOT AVAILABLE for 8 PASSENGER model
Traverse (Driver/Front)	2018 - 2023	* NOT AVAILABLE for Driver position with MANUAL SEAT
Traverse	2018 - 2023	* NOT AVAILABLE for 8 PASSENGER model
Equinox	2018 - 2024	* NOT AVAILABLE for EV / ELECTRIC VEHICLE
Terrain/ Equinox	2025 - 2027	* NOT AVAILABLE for EV / ELECTRIC VEHICLE
Kia Carnival	2022 - 2027	* NOT AVAILABLE for Driver position with MANUAL SEAT
Kia EV9	2023 - 2027	* NOT AVAILABLE for Relaxation comfort seat (leg rest)
Kia Sedona	☒ 2006 - 2014	* NOT AVAILABLE for short wheelbase model
Kia Sedona	2015 - 2021	* NOT AVAILABLE for mid-row driver side with OEM footrest <i>Discontinued in Canada 2019-2020 model</i>
Kia Telluride	2020 - 2025	* NOT AVAILABLE for model with MANUAL SEAT
Hyundai Palisade	2020 - 2025	* NOT AVAILABLE for model with MANUAL SEAT
Toyota Highlander	2020 - 2026	* NOT AVAILABLE for model with MANUAL SEAT
Toyota Sienna	2011 - 2020	* NOT AVAILABLE for 8-passenger 2 nd row on the driver side or for configurations equipped with the OEM footrest
Toyota Sienna	2021 - 2027	* NOT AVAILABLE for 8-passenger 2 nd row on the driver side or for configurations equipped with the OEM footrest
Toyota Tacoma	2024 - 2027	* NOT AVAILABLE for MANUAL SEATS
Toyota Tundra	2022 - 2027	* ONLY AVAILABLE for model with POWER SEATS
Toyota Rav 4	2019 - 2025	* ONLY AVAILABLE for model with MANUAL SEATS
Toyota Venza	☒ 2008 - 2016	* NOT AVAILABLE for model with power seats.
Volkswagen Atlas	2018 - 2022	* NOT AVAILABLE Front passenger for model manual seat
ALL MODEL		If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL
⚠ NOT AVAILABLE for 2007 model with integrated seatbelt:		
Avalanche / Escalade / Suburban / Tahoe / Yukon / Sierra / Silverado: Extended Cab / Crew Cab / HD (2500/3500)		

Tablet part #: **LK1000** | Bluetooth part #: **LK1100** | LINK footrest part #: **LK14000**

Need Assistance? [CHAT WITH US](#)

**2008-2020** Caravan / Town & Country | DRIVER**LK2-CHRG08L**

Seat height: OEM

OEM shrouds must be trimmed.

Outer seat shroud removed and replaced | PROVIDED

Power seat buttons integrated into provided shroud.

➔ Please specify if equipped with power seats.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

Transfer height: 19" | Average install: 6-8 hrs

Seat | FRONT: 2 inches less than OEM | BACK: 2 inches more than OEM

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Armrest must be modified | Retained. Action required for use.

OEM wire harness must be cut and extended under seat.

⚠ STEERING COLUMN MUST BE TELESCOPIC.

2008-2020 Caravan / Town & Country | FRONT PASSENGER**LK2-CHRG08R**

Seat height: OEM

OEM shrouds must be trimmed.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: OEM | BACK: OEM

OEM wire harness must be cut and extended under seat.

2008-2020 Caravan / Town & Country | 2nd ROW LEFT (driver side)**LK2-CHRG08CL**

Seat height: OEM

OEM shrouds must be trimmed.

➔ Please specify if equipped with heated seats. (Add. parts & time)

Transfer height: 19" | Average install: 6-8 hrs

Seat | FRONT: 5 inches more than OEM | BACK: OEM

⚠ Must be Stow 'N Go seating (not bench)

Option available: Additional Seat Security Anchor Kit

2008-2020 Caravan / Town & Country | 2nd ROW RIGHT (passenger side)**LK2-CHRG08CR**

Seat height: OEM

OEM shrouds must be trimmed.

➔ Please specify if equipped with heated seats. (Add. parts & time)

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 5 inches more than OEM | BACK: OEM

⚠ Must be Stow 'N Go seating (not bench)

Option available: Additional Seat Security Anchor Kit

2021-2027 Grand Caravan | DRIVER**LK2-CHR17L**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)

OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (additional install time)

➔ Please specify if equipped with power seats. (Add. parts & time)

Armrest must be modified | Adapter is included

Transfer height: 19" | Average install: 10-14 hrs

Seat | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

★ Adapt Solutions' signature TALL programming NOT AVAILABLE

USER INTERACTION REQUIRED: Watch video for details. [Click here for video](#)**2021-2027** Grand Caravan | FRONT PASSENGER**LK2-CHR17R**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)

OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (additional install time)

➔ Please specify if equipped with power seats. (Add. parts & time)

Transfer height: 19" | Average install: 10-14 hrs

Seat adjustments | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

2021-2027 Grand Caravan | 2nd ROW LEFT OR RIGHT (driver or passenger side)**LK2-CHR17CL or LK-CHR17CR**

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

➔ Please specify if equipped with heated seats. (Add. parts & time)

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: OEM | BACK: 1 ¾" more than OEM

Jump seat in 8 passenger model must be removed.

2017-2027 Pacifica | DRIVER**LK2-CHR17L**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)

OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (Additional install time)

➔ Please specify if equipped with power seats. (Add. parts & time)

Armrest must be modified | Adapter is included

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

Transfer height: 19" | Average install: 10-14 hrs

Seat | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

Compatible with HYBRID model.

★ Adapt Solutions' signature TALL programming NOT AVAILABLE

USER INTERACTION REQUIRED: Watch video for details. [Click here for video](#)

⚡ Transfer height depends on models and equipment, validate with our team before ordering.

⚡ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2017-2027 Pacifica | FRONT PASSENGER****LK2-CHR17R**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)
OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED
Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. **(Additional install time)**

➔ Please specify if equipped with power seats. (Add. parts & time)

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

“Transfer height: 19” | Average install: 10-14 hrs

Seat adjustments | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind **LINK PERMANENTLY** in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

Compatible with HYBRID model.

2017-2027 Pacifica | 2nd ROW LEFT OR RIGHT (driver or passenger side)**LK2-CHR17CL or LK-CHR17CR**

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

➔ Please specify if equipped with heated seats. (Add. parts & time)

➔ Please specify if it is hybrid or the Pinnacle model

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: OEM | BACK: 1 ¾" more than OEM

Jump seat in 8 passenger model must be removed.

2020-2027 Voyager | DRIVER**LK2-CHR17L**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)
OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. **(Additional install time)**

➔ Please specify if equipped with power seats. (Add. parts & time)

Armrest must be modified | Adapter is included

“Transfer height: 19” | Average install: 10-14 hrs

Seat | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind **LINK PERMANENTLY** in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**

USER INTERACTION REQUIRED: Watch video for details. [Click here for video](#)

2020-2027 Voyager | FRONT PASSENGER**LK2-CHR17R**

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point)
OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. **(additional install time)**

➔ Please specify if equipped with power seats. (Add. parts & time)

“Transfer height: 19” | Average install: 10-14 hrs

Seat adjustments | FRONT: 2 ¼" less than OEM | BACK: 2 ¼" more than OEM

Mid-row/Stow 'N Go behind **LINK PERMANENTLY** in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

2020-2027 Voyager | 2nd ROW LEFT OR RIGHT (driver or passenger side)**LK2-CHR17CL or LK-CHR17CR**

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

➔ Please specify if equipped with heated seats. (Add. parts & time)

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: OEM | BACK: 1 ¾" more than OEM

Jump seat in 8 passenger model must be removed.

2009-2023 Ram 1500 Crew Cab CLASSIC - 4 door | FRONT PASSENGER**LK2-RAMQ09R**

Seat height: OEM

OEM shrouds must be trimmed.

Seat support spring (OEM) must be cut | OEM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

“Transfer height: 21” | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

2009-2023 Ram 1500 Quad Cab CLASSIC - 4 door | FRONT PASSENGER**LK2-RAMQ09R**

Seat height: OEM

OEM shrouds must be trimmed.

Seat support spring (OEM) must be cut | OEM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

“Transfer height: 21” | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

2019-2027 Ram 1500 Quad Cab - 4 door | DRIVER**LK2-RAMQ19L**

Seat height: 2" higher than OEM lowest (2.5" adjustable seat)

OEM shrouds must be trimmed.

Door must be shimmed | SHIM PROVIDED

➔ Please specify if equipped with power seats.

➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: ½" more than OEM

OEM wire harness must be cut and extended under seat.

Adapt Solutions signature TALL programming **NOT AVAILABLE**.

NOT AVAILABLE for CLASSIC body style - 2018 model.

NOT AVAILABLE for TUNGSTEN TRIM LEVEL

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2019-2027 Ram 1500 Quad Cab - 4 door | FRONT PASSENGER****LK2-RAMQ19R**

Seat height: 2" higher than OEM lowest (2.5" adjustable seat)
OEM shrouds must be trimmed.

- ➔ Please specify if equipped with power seats.
- ➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL (RAMQ09R)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: ½" more than OEM
OEM wire harness must be cut and extended under seat.
NOT AVAILABLE for TUNGSTEN TRIM LEVEL

2019-2027 Ram 1500 Crew Cab - 4 door | DRIVER**LK2-RAMQ19L**

Seat height: 2" higher than OEM lowest (2.5" adjustable seat)
OEM shrouds must be trimmed.

- Door must be shimmed | SHIM PROVIDED
- ➔ Please specify if equipped with power seats.
 - ➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: ½" more than OEM
OEM wire harness must be cut and extended under seat.
★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**
NOT AVAILABLE for CLASSIC body style – 2018 model.
NOT AVAILABLE for TUNGSTEN TRIM LEVEL

2019-2027 Ram 1500 Crew Cab - 4 door | FRONT PASSENGER**LK2-RAMQ19R**

Seat height: 2" higher than OEM lowest (2.5" adjustable seat)
OEM shrouds must be trimmed.

- ➔ Please specify if equipped with power seats.
- ➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL (RAMQ09R)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: ½" more than OEM
OEM wire harness must be cut and extended under seat.
NOT AVAILABLE for TUNGSTEN TRIM LEVEL

2010-2018 Ram 2500/3500 - 4 door | FRONT PASSENGER**LK2-RAMQ09R**

Seat height: OEM
OEM shrouds must be trimmed.
Seat support spring (OEM) must be cut | OEM reconfiguration not affected
Higher trim levels may cause loss of some seat features.

“Transfer height: 23” | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
OEM wire harness must be cut and extended under seat.
Vented seat base fan removed from seat.

2019-2027 Ram 2500/3500 - 4 door | FRONT PASSENGER**LK2-RAMQ09R**

Seat height: OEM
OEM shrouds must be trimmed.
Seat support spring (OEM) must be cut | OEM reconfiguration not affected
Higher trim levels may cause loss of some seat features.

“Transfer height: 23” | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
OEM wire harness must be cut and extended under seat.
Vented seat base fan removed from seat.

**2018-2027 Jeep Wrangler – 4 door | DRIVER****LK2-WRG18L**

Seat height: $\frac{3}{4}$ " higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**

NOT AVAILABLE FOR MODEL WITH POWER SEAT

NOT AVAILABLE FOR JK MODEL (2018)

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2" more than OEM | BACK: 3 $\frac{1}{8}$ " less than OEM.

OEM wire harness must be cut and extended under seat.

Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

Compatible with HYBRID model.

2018-2027 Jeep Wrangler – 4 door | FRONT PASSENGER**LK2-WRG18R**

Seat height: $\frac{3}{4}$ " higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**

NOT AVAILABLE FOR MODEL WITH POWER SEAT

NOT AVAILABLE FOR JK MODEL (2018)

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2" more than OEM | BACK: 3 $\frac{1}{8}$ " less than OEM.

OEM wire harness must be cut and extended under seat.

Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

Compatible with HYBRID model.

2020-2027 Jeep Gladiator | DRIVER**LK2-WRG18L**

Seat height: $\frac{3}{4}$ " higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**

NOT AVAILABLE FOR MODEL WITH POWER SEAT

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2" more than OEM | BACK: 3 $\frac{1}{8}$ " less than OEM.

OEM wire harness must be cut and extended under seat.

Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

2020-2027 Jeep Gladiator | FRONT PASSENGER**LK2-WRG18R**

Seat height: $\frac{3}{4}$ " higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**

NOT AVAILABLE FOR MODEL WITH POWER SEAT

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2" more than OEM | BACK: 3 $\frac{1}{8}$ " less than OEM.

OEM wire harness must be cut and extended under seat.

Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

2011-2022 Jeep Grand Cherokee | FRONT PASSENGER**LK2-GCH11R**

Seat height: 1 $\frac{1}{2}$ inches higher than lowest point of adjustable seat (2 $\frac{1}{2}$ ")
OEM shrouds must be trimmed.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

“Transfer height: 19” | Average install: 6-8 hrs

Seat adjustments | FRONT: 1 $\frac{3}{4}$ more than OEM | BACK: 1 $\frac{3}{4}$ more than OEM

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for WL Platform

NOT AVAILABLE FOR MODEL WITH MANUAL SEATS.

2008-2020 ☒ Journey | FRONT PASSENGER**LK2-JOU08R**

Seat height: $\frac{1}{4}$ inch higher than OEM
OEM shrouds must be trimmed.

Plastic seat pan must be trimmed | OEM reconfiguration not affected

“Transfer height: 19” | Average install: 9-11 hrs

Seat adjustments | FRONT: $\frac{1}{4}$ more than OEM | BACK: $\frac{1}{4}$ more than OEM

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE FOR MODEL WITHOUT SEAT STORAGE

2009-2014 ☒ F-150 Super Cab – Suicide door | DRIVER**LK2-F150C09L**

Seat height: INFO N/A
OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

☛ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.

2009-2014 ☒ F-150 Super Cab – Suicide door | FRONT PASSENGER**LK2-F150C09R**

Seat height: INFO N/A
OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for model with 4 load cells. (SEE INSTALL PAGE)

2009-2014 ☒ F-150 Super Crew Cab – 4 door | DRIVER**LK2-F150C09L**

Seat height: INFO N/A
OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

☛ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.

**2009-2014** F-150 Super Crew Cab – 4 door | FRONT PASSENGER**LK2-F150C09R**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for model with 4 load cells. (SEE INSTALL PAGE)**2011-2016** F-150 Raptor Super Cab – Suicide door | DRIVER**LK2-F150C09L**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

☞ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.**2011-2016** F-150 Raptor Super Cab – Suicide door | FRONT PASSENGER**LK2-F150C09R**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for model with 4 load cells. (SEE INSTALL PAGE)**2011-2016** F-150 Raptor Super Crew Cab – 4 door | DRIVER**LK2-F150C09L**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

☞ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.**2011-2016** F-150 Raptor Super Crew Cab – 4 door | FRONT PASSENGER**LK2-F150C09R**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for model with 4 load cells. (SEE INSTALL PAGE)**2017-2027** F-150 Raptor Super Cab – Suicide door | DRIVER**LK2-F150C15L**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 21” | Average install: 10-12 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained.

☞ Please specify if equipped with power seats.

☞ Please specify if equipped with vented seat. (add. parts & time)

OEM wire harness must be cut and extended under seat.**2017-2027** F-150 Raptor Super Cab – Suicide door | FRONT PASSENGER**LK2-F150C15R**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 21” | Average install: 10-12 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained.

☞ Please specify if equipped with power seats.

☞ Please specify if equipped with vented seat. (add. parts & time)

OEM wire harness must be cut and extended under seat.**2017-2027** F-150 Raptor Super Crew Cab – 4 door | DRIVER**LK2-F150C15L**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 21” | Average install: 10-12 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained.

☞ Please specify if equipped with power seats.

☞ Please specify if equipped with vented seat. (Add. parts & time)

OEM wire harness must be cut and extended under seat.**2017-2027** F-150 Raptor Super Crew Cab – 4 door | FRONT PASSENGER**LK2-F150C15R**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 21” | Average install: 10-12 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained.

☞ Please specify if equipped with power seats.

☞ Please specify if equipped with vented seat. (Add. parts & time)

OEM wire harness must be cut and extended under seat.

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2015-2027 F-150 Super Cab – Suicide door | DRIVER****LK2-F150C15L**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.

2015-2027 F-150 Super Cab – Suicide door | FRONT PASSENGER**LK2-F150C15R**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.

2015-2027 F-150 Super Crew Cab – 4 door | DRIVER**LK2-F150C15L**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.

2015-2027 F-150 Super Crew Cab – 4 door | FRONT PASSENGER**LK2-F150C15R**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 20” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.

2011-2016 ☒ F-250, F-350, F-450 Super or Super Crew Cab – Suicide door or 4 door | DRIVER**LK2-F250C11L**

Seat height: ¼ inch higher than OEM (manual or power seat)
OEM shrouds must be trimmed.
OEM wire harness must be cut and extended under seat.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 24” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 inches less than OEM | BACK: OEM
☞ Please specify if equipped with power seats. (Add. parts & time)
☞ Please specify if equipped with vented seat. (Add. parts & time)
Transfer height is based on the F-250 model

2011-2016 ☒ F-250, F-350, F-450 Super or Super Crew Cab – Suicide or 4 door | FRONT PASSENGER**LK2-F250C11R**

Seat height: ¼ inch higher than OEM (manual or power seat)
OEM shrouds must be trimmed.
OEM wire harness must be cut and extended under seat.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 24” | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 inches less than OEM | BACK: OEM
☞ Please specify if equipped with power seats. (Add. parts & time)
☞ Please specify if equipped with vented seat. (Add. parts & time)
Transfer height is based on the F-250 model

2017-2027 F-250, F-350, F-450 Super Crew Cab – Suicide door or 4 door | DRIVER**LK2-F150C15L**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 24” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.
Transfer height is based on the 4X4 model

2017-2027 F-250, F-350, F-450 Super Crew Cab – Suicide or 4 door | FRONT PASSENGER**LK2-F150C15R**

Seat height: ½ inch lower than OEM (non-adjustable manual seat)
OEM shrouds must be trimmed.
Installation time varies depending on OEM features integrated in the seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.
Extensive wire harness work required on fully equipped models. (Add time)

“Transfer height: 24” | Average install: 8-10 hrs

Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM
Vented seatback retained.
☞ Please specify if equipped with power seats.
☞ Please specify if equipped with vented seat. (Add. parts & time)
OEM wire harness must be cut and extended under seat.
Transfer height is based on the 4X4 model

2019-2023 Ranger Super Crew Cab | FRONT PASSENGER**LK2-RNG19R**

Seat height: 1 1/16" higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.
Lower B pillar trim need to be cut | STENCIL PROVIDED

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: 1" less than OEM.
OEM wire harness must be cut and extended under seat.
NOT CURRENTLY AVAILABLE for SuperCab model.

☞ Transfer height depends on models and equipment, validate with our team before ordering.

☒ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2024-2027 Ranger Super Crew Cab | FRONT PASSENGER****LK2-RNG24R**

Seat height: 1^{7/8}" higher than OEM lowest (2-3/4" adjustable seat)
Outer seat trim must be modified | STENCIL PROVIDED
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Transfer height: 19" | Average install: 8-12 hrs

Seat adjustments | FRONT: 1/4" less than OEM | BACK: 2-1/2" more than OEM.
OEM wire harness must be cut and extended under seat.

2011-2015 Explorer | FRONT PASSENGER**LK2-EXL11R**

Seat height: INFO N/A
OEM shrouds must be trimmed.
Seat base must be cut | OEM reconfiguration not affected
Higher trim levels may cause loss of some seat features.

➔ Please specify if equipped with vented seat. (add. parts & time)

Transfer height: 19" | Average install: 8-10 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
OEM wire harness must be cut and extended under seat.
★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**.

2016-2019 Explorer | FRONT PASSENGER**LK2-EXL16R**

Seat height: 1" higher than OEM lowest (adjustable seat)
OEM shrouds must be trimmed.
Seat base must be cut | OEM reconfiguration not affected
OEM wire harness must be cut and extended under seat.

Transfer height: 19" | Average install: 9-11 hrs

Seat adjustments | FRONT: OEM | BACK: 1 3/4" less than OEM
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
Retain fan in seat | Models with ventilated seat.
➔ Please specify if equipped with vented seat. (add. parts & time)

2020-2027 Explorer | DRIVER**LK-EXL20L**

Seat height: 5/16" higher than OEM lowest (power seat)
OEM shrouds must be trimmed.
OEM wire harness must be cut and extended under seat.
★ Adapt Solutions' signature TALL programming **NOT AVAILABLE**.

Transfer height: 19.5" | Average install: 8-10 hrs

Seat adjustments | FRONT: 3/4" less than OEM | BACK: OEM
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
Control box relocated under the LINK.
NOT CURRENTLY AVAILABLE for model with manual seats.

2020-2027 Explorer | FRONT PASSENGER**LK2-EXL20R**

Seat height: 5/16" higher than OEM lowest (power seat)
OEM shrouds must be trimmed.
OEM wire harness must be cut and extended under seat.

Transfer height: 19.5" | Average install: 8-10 hrs

Seat adjustments | FRONT: 3/4" less than OEM | BACK: OEM
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
NOT CURRENTLY AVAILABLE for model with manual seats.

2007-2017 Expedition / Navigator | FRONT PASSENGER**LK2-EXP07R**

Seat height: 3/8 inch higher than OEM
OEM shrouds must be trimmed.
➔ Please specify if equipped with vented seats.
Installation time varies depending on OEM features integrated in the seat.
Extensive wire harness work required on fully equipped models. (Add time)

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 3/4 inch less than OEM | BACK: 1" more than OEM
Vented seats retained.
OEM wire harness must be cut and extended under seat.
Fully equipped model has large memory box module.
Additional time required for fastening memory box to the floor.

2018-2024 Expedition / Navigator | DRIVER**LK2-EXP18L**

Seat height: 1^{3/8}" higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.
➔ Please specify if equipped with vented seat. (add. parts & time)
NOT AVAILABLE for model with MANUAL SEAT.
NOT AVAILABLE for model with PERFECT POSITION SEAT (Navigator).

Transfer height: 21" | Average install: 8-12 hrs

Seat adjustments | FRONT: 4 1/8" less than OEM | BACK: 1^{1/4}" more than OEM
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
OEM wire harness must be cut and extended under seat.
Extensive wire harness work required on fully equipped models.
Additional time required for relocating memory box.
Plastic floor liner in 2nd row behind the LINK has to be cut or removed

2018-2024 Expedition / Navigator | FRONT PASSENGER**LK2-EXP18R**

Seat height: 1^{3/8}" higher than OEM lowest (adjustable seat)
OEM seat trim must be modified.
➔ Please specify if equipped with vented seat. (add. parts & time)
NOT AVAILABLE for model with MANUAL SEAT.
NOT AVAILABLE for model with PERFECT POSITION SEAT (Navigator).

Transfer height: 21" | Average install: 8-12 hrs

Seat adjustments | FRONT: 4 1/8" less than OEM | BACK: 1^{1/4}" more than OEM
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
OEM wire harness must be cut and extended under seat.
Extensive wire harness work required on fully equipped models.
Plastic floor liner in 2nd row behind the LINK has to be cut or removed

2018-2024 Expedition / Navigator | 2nd ROW LEFT (DRIVER SIDE)**LK2-EXP18CL**

Seat height: OEM
Lower C pillar shroud needs to be cut | STENCIL PROVIDED.
Left & right seat trim replaced | PROVIDED
➔ Please specify if equipped with heated seat. (add. parts & time)

Transfer height: 21" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: 2.5" more than OEM
OEM wire harness must be cut and extended under seat.
Seatback PowerFold feature cancelled | Seat cannot be folded
Seat tilt & slide feature no longer functional
Seatback recline no longer adjustable

⚠ **Must be Long wheelbase (Exp. MAX & Nav. L)**

Model with 2nd row center console may require LINK preset modification & decrease legroom during LINK operation
Inner arm rest must be removed.



2018-2024 Expedition / Navigator 2 nd ROW RIGHT (PASSENGER SIDE)	
LK2-EXP18CR Seat height: OEM Lower B pillar shroud needs to be cut STENCIL PROVIDED. Left & right seat trim replaced PROVIDED ➔ Please specify if equipped with heated seat. (add. parts & time) ⚠ Must be Long wheelbase (Exp. MAX & Nav. L) Model with 2 nd row center console may require LINK preset modification & decrease legroom during LINK operation Inner arm rest must be removed.	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 2" less than OEM BACK: 2.5" more than OEM OEM wire harness must be cut and extended under seat. Seatback PowerFold feature cancelled Seat cannot be folded Seat tilt & slide feature no longer functional Seatback recline no longer adjustable
2025-2027 Expedition / Navigator DRIVER	
LK2-EXP25L Seat height: 1 ^{3/8"} higher than OEM lowest (adjustable seat) OEM seat trim must be modified. ➔ Please specify if equipped with vented seat. (add. parts & time) NOT AVAILABLE for model with MANUAL SEAT . NOT AVAILABLE for model with PERFECT POSITION SEAT (Navigator) .	“Transfer height: 21” Average install: 8-12 hrs Seat adjustments FRONT: 4 ^{1/8"} less than OEM BACK: 1 ^{1/4"} more than OEM Lower B pillar shroud needs to be cut STENCIL PROVIDED. OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models. Additional time required for relocating memory box. Plastic floor liner in 2 nd row behind the LINK has to be cut or removed
2025-2027 Expedition / Navigator FRONT PASSENGER	
LK2-EXP25R Seat height: 1 ^{3/8"} higher than OEM lowest (adjustable seat) OEM seat trim must be modified. ➔ Please specify if equipped with vented seat. (add. parts & time) NOT AVAILABLE for model with MANUAL SEAT . NOT AVAILABLE for model with PERFECT POSITION SEAT (Navigator) .	“Transfer height: 21” Average install: 8-12 hrs Seat adjustments FRONT: 4 ^{1/8"} less than OEM BACK: 1 ^{1/4"} more than OEM Lower B pillar shroud needs to be cut STENCIL PROVIDED. OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models. Plastic floor liner in 2 nd row behind the LINK has to be cut or removed
2025-2027 Expedition / Navigator 2 nd ROW LEFT (DRIVER SIDE)	
LK2-EXP25CL Seat height: OEM Lower C pillar shroud needs to be cut STENCIL PROVIDED. Left & right seat trim replaced PROVIDED ➔ Please specify if equipped with heated seat. (add. parts & time) ⚠ Must be Long wheelbase (Exp. MAX & Nav. L) Model with 2 nd row center console may require LINK preset modification & decrease legroom during LINK operation Inner arm rest must be removed.	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 2" less than OEM BACK: 2.5" more than OEM OEM wire harness must be cut and extended under seat. Seatback PowerFold feature cancelled Seat cannot be folded Seat tilt & slide feature no longer functional Seatback recline no longer adjustable
2025-2027 Expedition / Navigator 2 nd ROW RIGHT (PASSENGER SIDE)	
LK2-EXP25CR Seat height: OEM Lower B pillar shroud needs to be cut STENCIL PROVIDED. Left & right seat trim replaced PROVIDED ➔ Please specify if equipped with heated seat. (add. parts & time) ⚠ Must be Long wheelbase (Exp. MAX & Nav. L) Model with 2 nd row center console may require LINK preset modification & decrease legroom during LINK operation Inner arm rest must be removed.	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 2" less than OEM BACK: 2.5" more than OEM OEM wire harness must be cut and extended under seat. Seatback PowerFold feature cancelled Seat cannot be folded Seat tilt & slide feature no longer functional Seatback recline no longer adjustable
2013-2019 Escape FRONT PASSENGER	
LK2-ESC13R Seat height: OEM OEM shrouds must be trimmed.	“Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: ½ inch less than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat.
2020-2026 Escape FRONT PASSENGER	
LK2-ESC20R Seat height: 2 5/16" higher than OEM lowest (adjustable seat)	“Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: OEM BACK: 1" less than OEM OEM seat trim must be modified.
2015-2024 Edge FRONT PASSENGER	
LK2-EDG15R Seat height: ¼" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if equipped with vented seat. (add. parts & time)	“Transfer height: 19” Average install: 10-12 hrs Seat adjustments FRONT: ¼" more than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models.
2016-2023 Lincoln MKX / Nautilus FRONT PASSENGER	
LK2-EDG15R Seat height: ¼" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if equipped with vented seat. (add. parts & time) ➔ Please specify if 22 position seat. (add. parts, manual & time)	“Transfer height: 19” Average install: 10-12 hrs Seat adjustments FRONT: ¼" more than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models.

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2007-2013** **Avalanche | DRIVER****LK2-SILC07L**

Seat height: ¾" higher than OEM (at lowest point on adjustable seat)
OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for 2007 model with seatbelt integrated into the seat

2007-2013 **Avalanche | FRONT PASSENGER****LK2-SILC07R**

Seat height: ¾" higher than OEM (at lowest point on adjustable seat)
OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for 2007 model with seatbelt integrated into the seat

2015-2022 **Canyon / Colorado Extended Cab – Suicide door | DRIVER****LK2-COLC15L**

Seat height: OEM (adjustable seat = 3" of travel – sits at 1 ½ inches)
OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 3/8" less than OEM | BACK: OEM

OEM wire harness must be cut and extended under seat.

⚠ Rear door must be open for LINK operation.

⚠ STEERING COLUMN MUST BE TELESCOPIC.

2015-2022 **Canyon / Colorado Extended Cab – Suicide door | FRONT PASSENGER****LK2-COLC15R**

Seat height: ¾" higher than OEM
OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 3/8" less than OEM | BACK: OEM

OEM wire harness must be cut and extended under seat.

⚠ Rear door must be open for LINK operation.

2015-2022 **Canyon / Colorado Crew Cab – 4 door | DRIVER****LK2-COLC15L**

Seat height: OEM (adjustable seat = 3" of travel – sits at 1 ½ inches)
OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 3/8" less than OEM | BACK: OEM

OEM wire harness must be cut and extended under seat.

⚠ STEERING COLUMN MUST BE TELESCOPIC.

2015-2022 **Canyon / Colorado Crew Cab – 4 door | FRONT PASSENGER****LK2-COLC15R**

Seat height: ¾" higher than OEM
OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 3/8" less than OEM | BACK: OEM

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

2023-2027 **Canyon / Colorado Crew Cab – 4 door | DRIVER****LK2-COLC23L**

Seat height: 2 13/16" higher than OEM
OEM shrouds must be trimmed.
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

➔ **Please specify if equipped with power seats.**

Black trims will be supplied for all interiors

Transfer height: 21" | Average install: 8-10 hrs

Seat adjustments | FRONT: 1.43" less than OEM | BACK: 1"

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

Vented seat base fan removed from seat.

TALL Preset not available for Driver Side

2023-2027 **Canyon / Colorado Crew Cab – 4 door | FRONT PASSENGER****LK2-COLC23R**

Seat height: 2 5/16" higher than OEM
OEM shrouds must be trimmed.
Lower B pillar shroud needs to be cut | STENCIL PROVIDED.
Black trims will be supplied for all interiors

Transfer height: 21" | Average install: 8-10 hrs

Seat adjustments | FRONT: 1 7/16" less than OEM | BACK: 7/8"

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

Vented seat base fan removed from seat.

2007-2013 **Sierra / Silverado Extended Cab-1500- Suicide door | DRIVER****LK2-SILX07L**

Seat height: ¾" higher than OEM (at lowest point on adjustable seat)
OEM shrouds must be trimmed.

Vented seat base fan removed from seat.

NOTE | If seatbelt is bolted to rocker panel, see required notes below:

Seat belt reel must be relocated | BRACKET PROVIDED

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE for 2007 model with seatbelt integrated into the seat

Replace rocker panel shroud | PROVIDED



2007-2013	Sierra / Silverado Extended Cab-1500- Suicide door FRONT PASSENGER
LK2-SILX07R	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Vented seat base fan removed from seat. NOTE If seatbelt is bolted to rocker panel, see required notes below: Seat belt reel must be relocated BRACKET PROVIDED Replace rocker panel shroud PROVIDED “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat
2014-2018	Sierra / Silverado Double Cab-1500- 4 door (2 smaller) DRIVER
LK2-SILC14L	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Lower B pillar shroud needs to be cut STENCIL PROVIDED. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL “Transfer height: 20” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Higher trim levels may cause loss of some seat features.
2014-2018	Sierra / Silverado Double Cab-1500- 4 door (2 smaller) FRONT PASSENGER
LK2-SILC14R	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Higher trim levels may cause loss of some seat features. “Transfer height: 20” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL
2007-2013	Sierra / Silverado Crew Cab-1500- 4 door DRIVER
LK2-SILC07L	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. Vented seat base fan removed from seat. “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat
2007-2013	Sierra / Silverado Crew Cab-1500- 4 door FRONT PASSENGER
LK2-SILC07R	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. Vented seat base fan removed from seat. “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat
2014-2018	Sierra / Silverado Crew Cab-1500- 4 door DRIVER
LK2-SILC14L	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Lower B pillar shroud needs to be cut STENCIL PROVIDED. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL “Transfer height: 20” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Higher trim levels may cause loss of some seat features.
2014-2018	Sierra / Silverado Crew Cab-1500- 4 door FRONT PASSENGER
LK2-SILC14R	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Higher trim levels may cause loss of some seat features. “Transfer height: 20” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL
2019-2026	Sierra / Silverado Crew Cab & Double Cab-1500- 4 door DRIVER
LK2-SILC19L	Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with seat memory. (add. parts & time) ➔ Please specify if equipped with vented seat. (add. parts & time) ➔ Please specify if LD / Limited or New Body Style (If older style, Vented seat base fan removed from seat) “Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches) If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL NOT AVAILABLE FOR ELECTRIC VEHICLE
2019-2026	Sierra / Silverado Crew Cab & Double Cab-1500- 4 door FRONT PASSENGER
LK2-SILC19R	Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with vented seat. (Add. parts & time) ➔ Please specify if LD / Limited or New Body Style (If older style, Vented seat base fan removed from seat) “Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL NOT AVAILABLE FOR ELECTRIC VEHICLE PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



2007-2014	Sierra / Silverado HD -2500 / 3500- Extended Cab – Suicide door	DRIVER
LK2-SILX07L	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Vented seat base fan removed from seat. Seat belt reel must be relocated BRACKET PROVIDED	“Transfer height: 23” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat NOTE If seatbelt is bolted to rocker panel, see required notes below: Replace rocker panel shroud PROVIDED
2007-2014	Sierra / Silverado HD -2500 / 3500- Extended Cab – Suicide door	FRONT PASSENGER
LK2-SILX07R	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Vented seat base fan removed from seat. NOTE If seatbelt is bolted to rocker panel, see required notes below:	“Transfer height: 23” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat Seat belt reel must be relocated BRACKET PROVIDED
2007-2014	Sierra / Silverado HD -2500 / 3500- Crew Cab – 4 door	DRIVER
LK2-SILC07L	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features.	“Transfer height: 23” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat.
2007-2014	Sierra / Silverado HD -2500 / 3500- Crew Cab – 4 door	FRONT PASSENGER
LK2-SILC07R	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features.	“Transfer height: 23” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat.
2015-2019	Sierra / Silverado HD -2500 / 3500- Double or Crew Cab	DRIVER
LK2-SILC14L	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Lower B pillar shroud needs to be cut STENCIL PROVIDED. 2500 model sits one inch higher than the 1500 & 3500 model.	“Transfer height: 20”-21” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Higher trim levels may cause loss of some seat features. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL
2015-2019	Sierra / Silverado HD -2500 / 3500- Double or Crew Cab	FRONT PASSENGER
LK2-SILC14R	Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Higher trim levels may cause loss of some seat features. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL	“Transfer height: 20”-21” Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. 2500 model sits one inch higher than the 1500 & 3500 model.
2020-2027	Sierra / Silverado HD -2500 / 3500- Double or Crew Cab	DRIVER
LK2-SILC19L	Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with seat memory. (add. parts & time) ➔ Please specify if equipped with vented seat. (add. parts & time)	“Transfer height: 25” Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. NOT AVAILABLE FOR ELECTRIC VEHICLE PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)
2020-2027	Sierra / Silverado HD -2500 / 3500- Double or Crew Cab	FRONT PASSENGER
LK2-SILC19R	Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with vented seat. (Add. parts & time) PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)	“Transfer height: 25” Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL NOT AVAILABLE FOR ELECTRIC VEHICLE
2007-2014	Escalade / Suburban / Tahoe / Yukon - All models	DRIVER
LK2-SILC07L	Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. Vented seat base fan removed from seat.	“Transfer height: 19” or 23” Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat HD models sit 4 inches higher. Estimated transfer height 23 inches from the ground.

“Transfer height depends on models and equipment, validate with our team before ordering.

LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



2007-2014 Escalade / Suburban / Tahoe / Yukon - All models FRONT PASSENGER	
LK2-SILC07R Seat height: ¾" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. Vented seat base fan removed from seat.	Transfer height: 19" or 23" Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. NOT AVAILABLE for 2007 model with seatbelt integrated into the seat HD models sit 4 inches higher. Estimated transfer height 23 inches from the ground.
2015-2020 Escalade / Suburban / Tahoe / Yukon - All models DRIVER	
LK2-SILC14L Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Lower B pillar shroud needs to be cut STENCIL PROVIDED. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL	Transfer height: 20" Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Higher trim levels may cause loss of some seat features.
2015-2020 Escalade / Suburban / Tahoe / Yukon - All models FRONT PASSENGER	
LK2-SILC14R Seat height: OEM OEM shrouds must be trimmed. Vented seatback retained. Higher trim levels may cause loss of some seat features.	Transfer height: 20" Average install: 7-9 hrs Seat adjustments FRONT: INFO N/A BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL
2021- 2027 Escalade / Suburban / Tahoe / Yukon - All models DRIVER	
LK2-SILC19L Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with seat memory. (add. parts & time) ➔ Please specify if equipped with vented seat. (add. parts & time)	Transfer height: 21" Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models. (Add time) If equipped with TV/DVD or SPEAKERS in seatback, NO LONGER FUNCTIONAL PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)
2021- 2027 Escalade / Suburban / Tahoe / Yukon - All models FRONT PASSENGER	
LK2-SILC19R Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Higher trim levels may cause loss of some seat features. ➔ Please specify if equipped with vented seat. (add. parts & time) ➔ Please specify if POWER SEAT.	Transfer height: 21" Average install: 6-8 hrs Seat adjustments FRONT: 2 ¼" less than OEM BACK: ¾" less than OEM OEM wire harness must be cut and extended under seat. If equipped with TV/DVD or SPEAKERS in seatback, NO LONGER FUNCTIONAL PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches) Extensive wire harness work required on fully equipped models. (Add time)
2008-2016 Acadia FRONT PASSENGER	
LK2-TRV08R Seat height: INFO N/A OEM shrouds must be trimmed. Vehicle battery access available Installation does not block access. GMC Acadia Limited 2017 (Built on 2016 body style)	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. Seat support spring (OEM) must be cut OEM reconfiguration not affected
2017-2025 Acadia DRIVER	
LK2-ACA17L Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud must be cut STENCIL PROVIDED ➔ Please specify if POWER SEAT. ★ Adapt Solutions' signature TALL programing NOT AVAILABLE . Door must be shimmed SHIM PROVIDED NOT AVAILABLE for 2017 ACADIA LIMITED MODEL	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM Vented seat base fan removed from seat. OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. Seat offset 1" to the left of the steering. If equipped with manual seats, recline handle is replaced PROVIDED
2017-2025 Acadia FRONT PASSENGER	
LK2-ACA17R Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) 2017 GMC Acadia Limited model use 2016 Acadia KIT ★ Adapt Solutions' signature TALL programing NOT AVAILABLE . ➔ Please specify if POWER SEAT.	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.
2024-2027 Acadia FRONT PASSENGER	
LK2-TRV24R Seat height: 2 3/16" higher than OEM lowest OEM shrouds must be trimmed.	Transfer height: 20" Average install: 8-10 hrs Seat adjustments FRONT: 1" less than OEM BACK: 1 ½" more than OEM OEM wire harness must be cut and extended under seat.

Transfer height depends on models and equipment, validate with our team before ordering.

LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



2017-2025 Cadillac XT6 DRIVER	
LK2-ACA17L Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud must be cut STENCIL PROVIDED ➔ Please specify if POWER SEAT. ★ Adapt Solutions' signature TALL programing NOT AVAILABLE . Door must be shimmed SHIM PROVIDED NOT AVAILABLE for 2017 ACADIA LIMITED MODEL	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM Vented seat base fan removed from seat. OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. Seat offset 1" to the left of the steering. If equipped with manual seats, recline handle is replaced PROVIDED
2017-2025 Cadillac XT6 FRONT PASSENGER	
LK2-ACA17R Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) 2017 GMC Acadia Limited model use 2016 Acadia KIT ★ Adapt Solutions' signature TALL programing NOT AVAILABLE . ➔ Please specify if POWER SEAT.	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.
2019-2026 Blazer DRIVER	
LK2-BLZ19L Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud must be cut STENCIL PROVIDED ➔ Please specify if POWER SEAT. ★ Adapt Solutions' signature TALL programing NOT AVAILABLE . Door must be shimmed SHIM PROVIDED NOT AVAILABLE for ELECTRIC MODEL (BLAZER EV)	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM ➔ Please specify if equipped with vented seat. (Add. parts & time) OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. Seat offset 1" to the left of the steering. If equipped with manual seats, recline handle is replaced PROVIDED
2019-2026 Blazer FRONT PASSENGER	
LK2-BLZ19R Seat height: 2 ½" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with vented seat. (Add. parts & time) ★ Adapt Solutions' signature TALL programing NOT AVAILABLE .	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ¾" less than OEM BACK: 1" less than OEM NOT AVAILABLE for ELECTRIC MODEL (BLAZER EV) OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.
2008-2017 Enclave FRONT PASSENGER	
LK2-TRV08R Seat height: INFO N/A OEM shrouds must be trimmed. Vehicle battery access available Installation does not block access.	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. Seat support spring (OEM) must be cut OEM reconfiguration not affected
2018-2024 Enclave DRIVER	
LK2-TRV18L Seat height: 3" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if equipped with vented seat. (Add. parts & time)	Transfer height: 19" Average install: 10-14 hrs Seat adjustments FRONT: 1¼" less than OEM BACK: ½" more than OEM OEM wire harness must be cut and extended under seat. Adapt Solutions' signature TALL programing NOT AVAILABLE . NOT AVAILABLE FOR MANUAL SEATS MODEL
2018-2024 Enclave FRONT PASSENGER	
LK2-TRV18R Seat height: 3" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if equipped with vented seat. (Add. parts & time)	Transfer height: 19" Average install: 10-14 hrs Seat adjustments FRONT: 1¼" less than OEM BACK: ½" more than OEM OEM wire harness must be cut and extended under seat. Adapt Solutions' signature TALL programing NOT AVAILABLE .
2025-2027 Enclave FRONT PASSENGER	
LK2-TRV24R Seat height: 2 3/16" higher than OEM lowest OEM shrouds must be trimmed.	Transfer height: 20" Average install: 8-10 hrs Seat adjustments FRONT: 1" less than OEM BACK: 1 ½" more than OEM OEM wire harness must be cut and extended under seat.
2008-2017 Traverse FRONT PASSENGER	
LK2-TRV08R Seat height: INFO N/A OEM shrouds must be trimmed. Vehicle battery access available Installation does not block access.	Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: INFO N/A BACK: INFO N/A OEM wire harness must be cut and extended under seat. Seat support spring (OEM) must be cut OEM reconfiguration not affected
2018-2023 Traverse DRIVER	
LK2-TRV18L Seat height: 3" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if equipped with vented seat. (add. parts & time)	Transfer height: 19" Average install: 10-14 hrs Seat adjustments FRONT: 1¼" less than OEM BACK: ½" more than OEM OEM wire harness must be cut and extended under seat. Adapt Solutions' signature TALL programing NOT AVAILABLE . NOT AVAILABLE FOR MANUAL SEATS MODEL

Transfer height depends on models and equipment, validate with our team before ordering.

LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



2018-2023	Traverse FRONT PASSENGER	
LK2-TRV18R	Seat height: 3" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if equipped with vented seat. (add. parts & time)	«Transfer height: 19" Average install: 10-14 hrs Seat adjustments FRONT: 1¼" less than OEM BACK: ½" more than OEM OEM wire harness must be cut and extended under seat. Adapt Solutions' signature TALL programming NOT AVAILABLE .
2018-2023	Traverse 2 nd ROW LEFT (driver side)	
LK2-TRV18CL	Seat height: OEM NOT AVAILABLE for 8 passenger model. ➔ Please specify if equipped with heated seat. (add. parts & time)	«Transfer height: 19" Average install: 4-6 hrs Seat adjustments FRONT: 2 ½" more than OEM BACK: 1" more than OEM Seatback recline no longer adjustable Remains completely upright. Seatback flat folding feature cancelled Cannot be folded.
2018-2023	Traverse 2 nd ROW RIGHT (passenger side)	
LK2-TRV18CR	Seat height: OEM Seatback recline no longer adjustable Remains completely upright. Seatback flat folding feature cancelled Cannot be folded.	«Transfer height: 19" Average install: 4-6 hrs Seat adjustments FRONT: 2 ½" more than OEM BACK: 1" more than OEM 'Smart Slide®' quick access to 3 rd row feature no longer functional. NOT AVAILABLE for 8 passenger model.
2024-2027	Traverse FRONT PASSENGER	
LK2-TRV24R	Seat height: 2 3/16" higher than OEM lowest OEM shrouds must be trimmed.	«Transfer height: 20" Average install: 8-10 hrs Seat adjustments FRONT: 1" less than OEM BACK: 1 ½" more than OEM OEM wire harness must be cut and extended under seat.
2018-2024	Enclave 2 nd ROW RIGHT (passenger side)	
LK2-TRV18CR	Seat height: OEM Seatback recline no longer adjustable Remains completely upright. Seatback flat folding feature cancelled Cannot be folded. ➔ Please specify if equipped with heated seat. (add. parts & time)	«Transfer height: 19" Average install: 4-6 hrs Seat adjustments FRONT: 2 ½" more than OEM BACK: 1" more than OEM 'Smart Slide®' quick access to 3 rd row feature no longer functional. NOT AVAILABLE for 8 passenger model.
2018-2024	Enclave 2 nd ROW LEFT (driver side)	
LK2-TRV18CL	Seat height: OEM NOT AVAILABLE for 8 passenger model. ➔ Please specify if equipped with heated seat. (add. parts & time)	«Transfer height: 19" Average install: 4-6 hrs Seat adjustments FRONT: 2 ½" more than OEM BACK: 1" more than OEM Seatback recline no longer adjustable Remains completely upright. Seatback flat folding feature cancelled Cannot be folded.
2010-2017	Terrain / Equinox FRONT PASSENGER	
LK2-TER10R	Seat height: OEM OEM shrouds must be trimmed. Outer seat shroud removed and replaced PROVIDED. ★ Adapt Solutions' signature TALL programming NOT AVAILABLE .	«Transfer height: 19" Average install: 5-7 hrs Seat adjustments FRONT: OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat. Seat recline handle removed and replaced PROVIDED.
2018-2024	Terrain / Equinox DRIVER	
LK2-TER18L	Seat height: 2 ¼" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud must be cut.	«Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: OEM BACK: ½" less than OEM OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. NOT AVAILABLE FOR EV MODEL
2018-2024	Terrain / Equinox FRONT PASSENGER	
LK2-TER18R	Seat height: 2" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. ★ Adapt Solutions' signature TALL programming NOT AVAILABLE . ➔ Please specify if POWER SEAT. ➔ Please specify if equipped with vented seat. (add. parts & time)	«Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: ½" more than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. NOT AVAILABLE FOR EV MODEL
2025-2027	Terrain / Equinox FRONT PASSENGER	
LK2-TER25R	Seat height: " higher than OEM lowest (" adjustable seat) OEM shrouds must be trimmed. Outer seat trim must be modified STENCIL PROVIDED ★ Adapt Solutions' signature TALL programming NOT AVAILABLE	«Transfer height: 19" Average install: 6-8 hrs Seat adjustments FRONT: 5/16" more than OEM BACK: 1/8" less than OEM OEM backrest lever replacement Seat belt retractor relocated. Automatic retraction may be affected. OEM wire harness must be cut and extended under seat. NOT AVAILABLE FOR EV MODEL

«Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2018-2027 Odyssey | 2nd ROW LEFT (driver side)****LK2-HDA18CL**

Seat height: 1 inch higher than OEM

Jump seat in 8 passenger model is retained.

CAUTION: Window of mid-row door must always be closed for LINK Operation. If open, door will not fully open. DANGER OF VEHICLE DAMAGE
If equipped with Magic Slide, the function is cancelled only at the seating position where the LINK is installed.

“Transfer height: 19” | Average install: 4-6 hrs

Seat adjustments | FRONT: 2 ¼ more than OEM | BACK: ¾ more than OEM

⚡ Please specify if 7 or 8 passengers.

Option Available: Adapt Solutions 100 pounds capacity Seat Anchor kit

2018-2027 Odyssey | 2nd ROW RIGHT (passenger side)**LK2-HDA18CR**

Seat height: 1 inch higher than OEM

Jump seat in 8 passenger model is retained.

CAUTION: Window of mid-row door must always be closed for LINK Operation. If open, door will not fully open. DANGER OF VEHICLE DAMAGE
If equipped with Magic Slide, the function is cancelled only at the seating position where the LINK is installed.

“Transfer height: 19”

Seat adjustments | FRONT: 2 ¼ more than OEM | BACK: ¾ more than OEM

⚡ Please specify if 7 or 8 passengers.

Option Available: Adapt Solutions 100 pounds capacity Seat Anchor kit

**2020-2025 Palisade | DRIVER****LK2-PAL20L**Seat height: 1 ¾" lower than OEM highest | 3/8" higher than OEM lowest
OEM shrouds must be trimmed | STENCIL PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Door must be shimmed | SHIM PROVIDED

If seat is equipped with extendable thigh support, feature is cancelled

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: 1 ¾" less than OEM | BACK: 1 ¾" more than OEM

OEM wire harness must be cut and extended under seat.

If your seat is equipped with ventilation, feature is cancelled

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

NOT AVAILABLE FOR MODELS WITH MANUAL SEAT**2020-2025 Palisade | FRONT PASSENGER****LK2-PAL20R**Seat height: 2 1/8" lower than OEM highest | 3/8" higher than OEM lowest
OEM shrouds must be trimmed | STENCIL PROVIDED

Door must be shimmed | SHIM PROVIDED

If seat is equipped with ventilation, feature is cancelled

“Transfer height: 19” | Average install: 10-12 hrs

Seat adjustments | FRONT: 1 ¾" less than OEM | BACK: 1 ¾" more than OEM

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

NOT AVAILABLE FOR MODELS WITH MANUAL SEAT**2023-2027 EV9 | DRIVER****LK2-EV924L**Seat height: 1 3/8" lower than OEM highest | 1" higher than OEM lowest
OEM shrouds must be trimmed | STENCIL PROVIDED

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

NOT AVAILABLE FOR MODELS WITH OEM POWER LEGS**“Transfer height: 19” | Average install: 8-10 hrs**

Seat adjustments | FRONT: 2" less than OEM | BACK: 3" more than OEM

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

Fabric flap behind the seat has to be cut & modified

2023-2027 EV9 | FRONT PASSENGER**LK2-EV924R**Seat height: 1 7/8" lower than OEM highest | 1" higher than OEM lowest
OEM shrouds must be trimmed | STENCIL PROVIDED**NOT AVAILABLE FOR MODELS WITH OEM POWER LEGS**

Vented seat base fan removed from seat.

“Transfer height: 19” | Average install: 8-10 hrs

Seat adjustments | FRONT: 2" less than OEM | BACK: 3" more than OEM

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

Fabric flap behind the seat has to be cut & modified

2006-2014 ⚡ Sedona | 2nd ROW LEFT (driver side)**LK2-KIA06CL**

Seat height: ½ inch higher than OEM

OEM shrouds must be trimmed.

“Transfer height: 19” | Average install: 4-6 hrs

Seat adjustments | FRONT: 1 ½ more than OEM | BACK: 1" more than OEM

⚠ **MUST BE A LONG WHEELBASE – NOT AVAILABLE FOR SHORT WHEELBASE.****2006-2014 ⚡ Sedona | 2nd ROW RIGHT (passenger side)****LK2-KIA06CR**

Seat height: ½ inch higher than OEM

OEM shrouds must be trimmed.

“Transfer height: 19” | Average install: 4-6 hrs

Seat adjustments | FRONT: 1 ½ more than OEM | BACK: 1" more than OEM

⚠ **MUST BE A LONG WHEELBASE – NOT AVAILABLE FOR SHORT WHEELBASE.**

⚡ Transfer height depends on models and equipment, validate with our team before ordering.

⚡ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

2020-2025	Telluride DRIVER
LK2-PAL20L	“Transfer height: 19” Average install: 10-12 hrs Seat height: 1 3/4" lower than OEM highest 3/8" higher than OEM lowest OEM shrouds must be trimmed STENCIL PROVIDED Lower B pillar shroud needs to be cut STENCIL PROVIDED. Door must be shimmed SHIM PROVIDED If seat is equipped with extendable thigh support, feature is cancelled Seat adjustments FRONT: 1 3/4" less than OEM BACK: 1 3/4" more than OEM OEM wire harness must be cut and extended under seat. If your seat is equipped with ventilation, feature is cancelled Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees NOT AVAILABLE FOR MODELS WITH MANUAL SEAT
2020-2025	Telluride FRONT PASSENGER
LK2-PAL20R	“Transfer height: 19” Average install: 10-12 hrs Seat height: 2 1/8" lower than OEM highest 3/8" higher than OEM lowest OEM shrouds must be trimmed STENCIL PROVIDED Door must be shimmed SHIM PROVIDED If seat is equipped with ventilation, feature is cancelled Seat adjustments FRONT: 1 3/4" less than OEM BACK: 1 3/4" more than OEM OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees NOT AVAILABLE FOR MODELS WITH MANUAL SEAT
2015-2021	Sedona FRONT PASSENGER
LK2-KIA16R	“Transfer height: 19” Average install: 6-8 hrs Seat height: OEM (adjustable seat = 3" of travel – sits 1" higher than lowest) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. Please specify if POWER SEATS additional parts supplied. Seat adjustments FRONT: 3/4" less than OEM BACK: 1 1/4" more than OEM OEM wire harness must be cut and extended under seat. Higher trim levels may cause loss of some seat features. Vented seat base fan removed from seat.
2015-2021	Sedona 2 nd ROW LEFT (driver side)
LK2-KIA16CL	“Transfer height: 19” Average install: 7-9 hrs Seat height: OEM OEM shrouds must be trimmed. Please specify if equipped with heated seats. (Add. parts & time) Seat adjustments FRONT: 1 1/2" more than OEM BACK: OEM NOT AVAILABLE FOR MODELS WITH OEM FOOTREST Discontinued in Canada 2019-2020 model.
2015-2021	Sedona 2 nd ROW RIGHT (passenger side)
LK2-KIA16CR	“Transfer height: 19” Average install: 7-9 hrs Seat height: OEM OEM shrouds must be trimmed. Please specify if equipped with OEM footrest LK-KIA16CFR (Footrest removed) Seat adjustments FRONT: 1 1/2" more than OEM BACK: OEM Please specify if equipped with heated seats. (Add. parts & time)
2022-2027	Carnival DRIVER
LK2-KIA22L	“Transfer height: 19” Average install: 10-12 hrs Seat height: 1 3/4" lower than OEM highest 1 1/4" higher than OEM lowest B pillar shroud needs to be cut STENCIL PROVIDED OEM seat trim must be modified STENCIL PROVIDED Please specify if equipped with seat memory. (Add. parts & time) Adapt Solutions' signature TALL programing NOT AVAILABLE Compatible with HYBRID model. Seat adjustments FRONT: 1/4" less than OEM BACK: 3/4" more than OEM OEM wire harness must be cut and extended under seat. Floor mat behind the LINK has to be removed or modified Fabric flap behind the seat has to be cut & modified Vented seat base fan removed from seat. NOT AVAILABLE FOR MODELS WITH MANUAL SEAT.
2022-2027	Carnival FRONT PASSENGER
LK2-KIA22R	“Transfer height: 19” Average install: 10-12 hrs Seat height: 1 1/8" higher than OEM highest 1 1/8" higher than OEM lowest OEM seat trim must be modified STENCIL PROVIDED Control box needs to be relocated. Custom tool provided for access to spare wheel under LINK. Please specify if POWER SEATS different install manual supplied. Compatible with HYBRID model. Seat adjustments FRONT: 1 7/8" less than OEM BACK: 1 3/8" more than OEM OEM wire harness must be cut and extended under seat. Occupant sensor plug must be extended directly from the floor Floor mat behind the LINK has to be removed or modified Fabric flap behind the seat has to be cut & modified Vented seat base fan removed from seat.
2022-2027	Carnival 2 nd ROW LEFT (driver side)
LK2-KIA22CL	“Transfer height: 18 1/4” Average install: 6-8 hrs Seat height: 9/16" higher than OEM highest 9/16" higher than OEM lowest OEM seat trim must be modified STENCIL PROVIDED Please specify if equipped with OEM footrest VIP Lounge Seating – Relaxation Mode feature NO LONGER FUNCTIONAL Seat adjustments FRONT: 1 7/8" less than OEM BACK: 1" less than OEM Rear foam of the seat cushion must be modified Compatible with HYBRID model.
2022-2027	Carnival 2 nd ROW RIGHT (passenger side)
LK2-KIA22CR	“Transfer height: 18 1/4” Average install: 6-8 hrs Seat height: 9/16" higher than OEM highest 9/16" higher than OEM lowest OEM seat trim must be modified STENCIL PROVIDED Please specify if equipped with OEM footrest VIP Lounge Seating – Relaxation Mode feature NO LONGER FUNCTIONAL Seat adjustments FRONT: 1 7/8" less than OEM BACK: 1" less than OEM Rear foam of the seat cushion must be modified Compatible with HYBRID model.



2011-2020	Sienna DRIVER
LK2-TOY11L	Seat height: OEM (Manual seat) 1" lower than OEM top (adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if POWER SEATS additional parts supplied. ➔ Please specify if ALL WHEEL DRIVE additional parts supplied. “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 3.5" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Armrest must be modified Retained. Action required for use. ➔ Please specify if ADJUSTABLE ARMREST WITH BUTTON. PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)
2011-2020	Sienna FRONT PASSENGER
LK2-TOY11R	Seat height: OEM (Manual seat) 1" lower than OEM top (adjustable seat) OEM shrouds must be trimmed. ➔ Please specify if POWER SEATS additional parts supplied. ➔ Please specify if JBL SOUND SYSTEM additional parts supplied. “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 3.5" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. ➔ Please specify if ALL WHEEL DRIVE additional parts supplied. PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)
2011-2020	Sienna 2 nd ROW LEFT (driver side)
LK2-TOY11CL	Seat height: OEM OEM shrouds must be replaced PROVIDED. PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY) ➔ Please specify if equipped with OEM footrest LK-TOY11CFL Footrest removed “Transfer height: 19” Average install: 7-9 hrs Seat adjustments FRONT: 5 ¼" less than OEM BACK: OEM (9" travel) Gas tank must be partially lowered to access floor adaptor bolts. NOT AVAILABLE FOR 8 PASSENGER SIENNA (60/40 SPLIT)
2011-2020	Sienna 2 nd ROW RIGHT (passenger side)
LK2-TOY11CR	Seat height: OEM OEM shrouds must be replaced PROVIDED. ➔ Please specify if equipped with OEM footrest LK-TOY11CFR Footrest removed “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 5 ¼" less than OEM BACK: OEM (9" travel) PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY) NOT AVAILABLE FOR 8 PASSENGER with OEM Footrest
2021-2027	Sienna DRIVER
LK2-TOY21L	Seat height: OEM OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if POWER SEATS additional parts supplied. ➔ Please specify if SEAT is equipped with LUMBAR SUPPORT. “Transfer height: 19” Average install: 8-12 hrs Seat adjustments FRONT: 3" less than OEM BACK: 2 1/2" more than OEM OEM wire harness must be cut and extended under seat. Fan removed from seat and seatback. ★ Adapt Solutions' signature TALL programming NOT AVAILABLE. Black trims will be supplied for all interiors
LIMITED SPACE TIGHT APPLICATION. Watch video for details. Click here	
2021-2027	Sienna FRONT PASSENGER
LK2-TOY21R	Seat height: OEM OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if POWER SEATS additional parts supplied. Black trims will be supplied for all interiors “Transfer height: 19” Average install: 8-12 hrs Seat adjustments FRONT: 3.5" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Fan removed from seat and seatback. ★ Adapt Solutions' signature TALL programming NOT AVAILABLE.
2021-2027	Sienna 2 nd ROW LEFT (driver side)
LK2-TOY21CL	Seat height: 5/16" higher than OEM OEM wire harness must be cut and extended under seat. ➔ Please specify if equipped with OEM footrest “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 7/8" more than OEM BACK: 3 1/4" less than OEM. NOT AVAILABLE FOR 8 PASSENGER SIENNA (60/40 SPLIT) Black trims will be supplied for all interiors
2021-2027	Sienna 2 nd ROW RIGHT (passenger side)
LK2-TOY21CR	Seat height: 5/16" higher than OEM OEM wire harness must be cut and extended under seat. ➔ Please specify if 8 passengers LK-TOY21C8R. “Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 7/8" more than OEM BACK: 3 1/4" less than OEM. NOT AVAILABLE FOR 8 PASSENGER with OEM Footrest Black trims will be supplied for all interiors
2005-2023	Tacoma Access Cab – Suicide door FRONT PASSENGER
LK2-TACD05R	Seat height: 1" higher than OEM OEM shrouds must be trimmed. ★ Adapt Solutions' signature TALL programming NOT AVAILABLE. “Transfer height: 19” Average install: 4-6 hrs Seat adjustments FRONT: 1/2" less than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat.
2005-2023	Tacoma Double Cab – 4 door FRONT PASSENGER
LK2-TACD05R	Seat height: 1" higher than OEM OEM shrouds must be trimmed. “Transfer height: 19” Average install: 4-6 hrs Seat adjustments FRONT: 1/2" less than OEM BACK: 1" less than OEM OEM wire harness must be cut and extended under seat.

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



2024-2027 Tacoma Double Cab – 4 door DRIVER	
LK2-TACD24L Seat height: OEM highest 2 5/8" higher than OEM lowest OEM shrouds must be trimmed. Door must be shimmed SHIM PROVIDED ★ Adapt Solutions' signature TALL programing NOT AVAILABLE	“Transfer height: 22” Average install: 8-10 hrs Seat adjustments FRONT: OEM BACK: 1/8" less than OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. <i>Black trims will be supplied for all interiors</i> NOT AVAILABLE FOR MANUAL SEATS.
2024-2027 Tacoma Double Cab – 4 door FRONT PASSENGER	
LK2-TACD24R Seat height: 2 7/8" higher than OEM highest OEM shrouds must be trimmed. Door must be shimmed SHIM PROVIDED ★ Adapt Solutions' signature TALL programing NOT AVAILABLE	“Transfer height: 19 1/2” Average install: 8-10 hrs Seat adjustments FRONT: OEM BACK: 1/8" less than OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. <i>Black trims will be supplied for all interiors</i> NOT AVAILABLE FOR MANUAL SEATS.
2014-2021 Tundra Double Cab - 4 door (2 smaller) DRIVER	
LK2-TUN14L Seat height: OEM (Manual seat) 1" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if 12 way seat (power thigh) additional parts supplied.	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 1" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Vented seat base fan retained. <i>Higher trim levels may cause loss of some seat features.</i>
2014-2021 Tundra Double Cab - 4 door (2 smaller) FRONT PASSENGER	
LK2-TUN14R Seat height: OEM (Manual seat) 1" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. <i>Higher trim levels may cause loss of some seat features.</i>	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 1" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. (In LIMITED & 1794)
2014-2021 Tundra Crew Max – 4 door DRIVER	
LK2-TUN14L Seat height: OEM (Manual seat) 1" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if 12 way seat (power thigh) additional parts supplied.	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 1" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Vented seat base fan retained. <i>Higher trim levels may cause loss of some seat features.</i>
2014-2021 Tundra Crew Max – 4 door FRONT PASSENGER	
LK2-TUN14R Seat height: OEM (Manual seat) 1" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. <i>Higher trim levels may cause loss of some seat features.</i>	“Transfer height: 21” Average install: 6-8 hrs Seat adjustments FRONT: 1" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. (In LIMITED & 1794)
2022-2027 Tundra Crew Max – 4 door DRIVER	
LK2-TUN22L Seat height: 2" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. Door must be shimmed SHIM PROVIDED Control box needs to be relocated. Lower B pillar shroud needs to be cut STENCIL PROVIDED. ➔ Please specify if 12 way seat (power thigh) additional parts supplied.	“Transfer height: 21 1/2” Average install: 8-10 hrs Seat adjustments FRONT: 1/2" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Fabric flap behind the seat has to be cut & modified Vented seat removed NOT AVAILABLE FOR MANUAL SEATS MODEL
2022-2027 Tundra Crew Max – 4 door FRONT PASSENGER	
LK2-TUN22R Seat height: 2" higher than OEM lowest (adjustable seat) OEM shrouds must be trimmed. Door must be shimmed SHIM PROVIDED Control box needs to be relocated & Vented seat removed Lower B pillar shroud needs to be cut STENCIL PROVIDED	“Transfer height: 21 1/2” Average install: 8-10 hrs Seat adjustments FRONT: 1/2" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Fabric flap behind the seat has to be cut & modified NOT AVAILABLE FOR MANUAL SEATS MODEL
2013-2018 Rav 4 FRONT PASSENGER	
LK2-RAV13R Seat height: 1/2" higher than OEM OEM shrouds must be trimmed. ➔ Please specify if POWER SEATS additional parts supplied.	“Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 3 1/4" less than OEM BACK: 2 1/4" more than OEM OEM wire harness must be cut and extended under seat.
2019-2025 Rav 4 FRONT PASSENGER	
LK2-RAV19R Seat height: 1/2" higher than OEM OEM shrouds must be trimmed. Door must be shimmed SHIM PROVIDED ★ Adapt Solutions' signature TALL programing NOT AVAILABLE Compatible with HYBRID model.	“Transfer height: 19” Average install: 6-8 hrs Seat adjustments FRONT: 1/2" less than OEM BACK: OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. NOT AVAILABLE FOR ELECTRIC SEATS MODEL

“Transfer height depends on models and equipment, validate with our team before ordering.

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

**2008-2016** Venza | FRONT PASSENGER**LK2-VNZ08R**

Seat height: INFO N/A

OEM shrouds must be trimmed.

Door opening increased with shim | PROVIDED.

★ Adapt Solutions' signature TALL programing **NOT AVAILABLE**.**Transfer height: 19" | Average install: 5-7 hrs**

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

NOT AVAILABLE IF EQUIPPED WITH POWER SEAT ON PASSENGER SIDE.**2014-2019** Highlander | FRONT PASSENGER**LK2-HLD14R**

Seat height: OEM

OEM shrouds must be trimmed.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

➔ Please specify if POWER SEATS | additional parts supplied.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 2 ¼" less than OEM. | BACK: 1 ¼" more than OEM

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

Vented seatback retained.

2020-2027 Grand Highlander | FRONT PASSENGER**LK2-HLD24R**

Seat height: 1 3/8" lower than OEM highest | 7/8" higher than OEM lowest

OEM shrouds must be trimmed.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Compatible with HYBRID model**Transfer height: 19" | Average install: 8-10 hrs**

Seat adjustments | FRONT: 7/8" less than OEM | BACK: 1 1/8" more than OEM

Vented seat base fan removed from seat.

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

2020-2026 Highlander | FRONT PASSENGER**LK2-HLD24R**

Seat height: 1 3/8" lower than OEM highest | 7/8" higher than OEM lowest

OEM shrouds must be trimmed.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Compatible with HYBRID model.**Transfer height: 19" | Average install: 8-10 hrs**

Seat adjustments | FRONT: 7/8" less than OEM | BACK: 1 1/8" more than OEM

Vented seat base fan removed from seat.

OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

NOT AVAILABLE FOR MANUAL SEATS.**Volkswagen****2009-2012** Routan | DRIVER**LK2-CHRG08L**

Seat height: OEM

OEM shrouds must be trimmed.

Outer seat shroud removed and replaced | PROVIDED

Power seat buttons integrated into provided shroud.

➔ Please specify if equipped with power seats.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

Armrest must be removed | COVER CAP PROVIDED.

OEM wire harness must be cut and extended under seat.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

2009-2012 Routan | FRONT PASSENGER**LK2-CHRG08R**

Seat height: OEM

OEM shrouds must be trimmed.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

2009-2012 Routan | 2nd ROW LEFT (driver side)**LK2-CHRG08CL**

Seat height: OEM

OEM shrouds must be trimmed.

Transfer height: 19" | Average install: 6-8 hrs

Seat | FRONT: 5 inches more than OEM | BACK: OEM

⚠ **Must be Stow 'N Go seating (not bench)****2009-2012** Routan | 2nd ROW RIGHT (passenger side)**LK2-CHRG08CR**

Seat height: OEM

OEM shrouds must be trimmed.

Transfer height: 19" | Average install: 6-8 hrs

Seat adjustments | FRONT: 5 inches more than OEM | BACK: OEM

⚠ **Must be Stow 'N Go seating (not bench)****2018-2026** Atlas | DRIVER**LK2-ATL18L**

Seat height: 1" lower than OEM highest | 1 ½" higher than OEM lowest

Outer seat trim panel modified. Inner trim panel cut | STENCIL PROVIDED.

Lower B-pillar shroud needs to be trimmed | STENCIL PROVIDED.

➔ Please specify if equipped with seat memory (add parts & time)

Memory control needs to be relocated.

Transfer height: 19" | Average install: 8-10 hrs

Seat adjustments | FRONT: 1 ½" less than OEM | BACK: 2 ½" more than OEM

OEM wire harness must be cut and extended under seat.

Fabric flap behind the seat has to be cut & modified

★ Adapt Solutions' signature TALL programing **NOT AVAILABLE**.

Black trims will be supplied for all interiors

LIMITED SPACE | TIGHT APPLICATION.

⚡ Transfer height depends on models and equipment, validate with our team before ordering.

⚡ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.



Volkswagen

2018-2026 Atlas | FRONT PASSENGER

LK2-ATL18R

Seat height: 1" lower than OEM highest | 1 ½" higher than OEM lowest
OEM shrouds must be trimmed. | STENCIL PROVIDED.
Lower B-pillar shroud needs to be trimmed | STENCIL PROVIDED.

➔ Please specify if Manual Seat.

NOT AVAILABLE model for manual seats between 2018-2022

Transfer height: 19" | Average install: 8-10 hrs

Seat adjustments | FRONT: 2 ½" less than OEM | BACK: 1 ½" more than OEM

OEM wire harness must be cut and extended under seat.

Fabric flap behind the seat has to be cut & modified

★ Adapt Solutions' signature TALL programing **NOT AVAILABLE**

Black trims will be supplied for all interiors

2025-2027 ID BUZZ | DRIVER

LK2-BUZ25L

Seat height: 7/16" higher than OEM lowest (2-7/16" adjustable seat)
Lower B-pillar shroud needs to be trimmed | STENCIL PROVIDED.
Outer and inner seat trim must be modified | STENCIL PROVIDED

Transfer height: 19" | Average install: 8-10 hrs

Seat adjustments | FRONT: 2-1/16" less than OEM | BACK: 5/8" less than OEM

OEM wire harness must be cut and extended under seat.

Black trims will be supplied for all interiors

2025-2027 ID BUZZ | FRONT PASSENGER

LK2-BUZ25R

Seat height: 7/16" higher than OEM lowest (2-7/16" adjustable seat)
Lower B-pillar shroud needs to be trimmed | STENCIL PROVIDED.
Outer and inner seat trim must be modified | STENCIL PROVIDED

Transfer height: 19-7/16" | Average install: 8-10 hrs

Seat adjustments | FRONT: 2-1/16" less than OEM | BACK: 5/8" less than OEM

OEM wire harness must be cut and extended under seat.

Black trims will be supplied for all interiors

ASENTO | XL-SEAT

HI-LIFT



FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all of the key features of the product.



PRODUCT VIDEO

Overview of the ASENTO & SPEEDY-LIFT in motion.



HIGHLIGHTS:

- OEM seat and adjustments remain intact
- Easy to use, foldable and removable transfer board.
- Can be paired with the SPEEDY-LIFT
- Driver or front passenger applications available
- 3-year warranty
- 275 lbs capacity.



THINGS TO NOTE

OEM plastic shroud and trim might be modified or replaced on a per vehicle basis for the transfer board operation. If additional information is required, we, or our authorized dealers, will provide information needed on request.



XL SEAT | ASENTO QUICK REFERENCE

★ = HI-LIFT available with XL-SEAT
HI-LIFT NOT AVAILABLE with ASENTO

page 1 of 4

CHRYSLER		DRIVER	FRONT PASSENGER
Caravan / Grand Caravan / Town & Country	2008 - 2020 ★	✓	✓
Grand Caravan	2021 - 2027	✓	✓
Jeep Wrangler - 4 door	2007 - 2018	✓*	✓*
Pacifica	2017 - 2027	✓	✓
Ram 1500 2500 3500 Reg Cab - 2 door	2003 - 2009	✓	✓
Ram 1500 2500 3500 Quad Cab - 4 door	2003 - 2009	✓	✓
Ram 1500 2500 3500 Crew/Mega Cab - 4 door	2006 - 2009	✓	✓
Ram 1500 CLASSIC Crew Cab - 4 door	2009 - 2024	✓	✓
Ram 1500 Crew Cab - 4 door	2019 - 2027	✓*	✓*
Ram 1500 CLASSIC Quad Cab - 4 door	2009 - 2024	✓	✓
Ram 1500 Quad Cab - 4 door	2019 - 2027	✓*	✓*
Ram 2500/3500 Crew/Mega Cab - 4 door	2010 - 2018	✓	✓
Voyager	2020 - 2027	✓	✓
FORD		DRIVER	FRONT PASSENGER
Edge	2011 - 2014	✓	✓
Edge	2015 - 2024	✓	✓
Explorer	2011 - 2019	✓	✓
Explorer	2020 - 2027	✓*	✓*
Expedition / Navigator	2018 - 2024	✓*	✓*
F-150 Reg Cab - 2 door	2004 - 2008	✓	✓
F-150 Reg Cab - 2 door, small suicide door	2009 - 2010	✓	✓
F-150 Super Cab - Suicide door	2004 - 2008	✓*	✓*
F-150 Super Cab - Suicide door	2009 - 2014	✓*	✓*
F-150 Super Cab - Suicide door	2015 - 2027	✓*	✓*
F-150 Super Crew Cab - 4 door	2004 - 2008	✓	✓
F-150 Super Crew Cab - 4 door	2009 - 2014	✓	✓
F-150 Super Crew Cab - 4 door	2015 - 2017	✓	✓
F-150 Super Crew Cab - 4 door	2018 - 2027	✓	✓
F-250, F-350, F-450 Super Cab - Suicide door	2008 - 2016	✓	✓
F-250, F-350, F-450 Super Cab - Suicide door	2017 - 2027	✓	✓
F-250, F-350, F-450 Super Crew - 4 door	2008 - 2016	✓	✓
F-250, F-350, F-450 Super Crew - 4 door	2017 - 2027	✓	✓
Lincoln MKX	2016 - 2018	✓	✓
Mark LT - 4 door	2006 - 2008	✓	✓
Nautilus	2019 - 2023	✓	✓
Transit Connect	2010 - 2013	✓	✓

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

“Transfer height depends on models and equipment, validate with our team before ordering.

ADAPT SOLUTIONS
BACK
09-2026

XL SEAT/ASENTO QUICK REFERENCE

page 2 of 4

FORD		DRIVER	FRONT PASSENGER
Ranger Super Crew Cab – 4 Door	2019 - 2023	✓	✓
Ranger Super Crew Cab – 4 Door	2024 - 2027	✓	✓
Raptor Super Cab - Suicide door	☒ 2011 - 2016	✓*	✓*
Raptor Super Cab - Suicide door	2017 - 2027	✓*	✓*
Raptor Super Crew Cab - 4 door	☒ 2011 - 2016	✓	✓
Raptor Super Crew Cab - 4 door	2017 - 2027	✓	✓
GENERAL MOTORS		DRIVER	FRONT PASSENGER
Acadia	2017 - 2023	✓	✓
Avalanche	☒ 2007 - 2010	✓	✓
Avalanche	☒ 2011 - 2013	✓	✓
Blazer	2019 - 2026	✓*	✓*
Canyon / Colorado Extended Cab - Suicide door	☒ 2004 - 2012	✓	✓
Canyon / Colorado Extended Cab - Suicide door	☒ 2015 - 2022	✓	✓
Canyon / Colorado Crew Cab – 4 door	☒ 2015 - 2022	✓	✓
Canyon / Colorado Crew Cab – 4 door	2023 - 2027	✓	✓
Escalade / Suburban / Tahoe / Yukon - All models	☒ 2007 - 2010	✓	✓
Escalade / Suburban / Tahoe / Yukon - All models	2011 - 2014	✓	✓
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	✓	✓
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2027	✓	✓
Sierra / Silverado Regular Cab - 2 door	☒ 1999 - 2006	✓	✓
Sierra / Silverado Extended Cab - Without suicide door	☒ 1999 - 2002	✓	✓
Sierra / Silverado Extended Cab - Suicide door	☒ 2001 - 2006	✓	✓
Sierra / Silverado Extended Cab - Suicide door	☒ 2007 - 2013	✓	✓
Sierra / Silverado Crew Cab - 4 door	☒ 2007 - 2010	✓	✓
Sierra / Silverado Crew Cab - 4 door	☒ 2011 - 2013	✓	✓
Sierra / Silverado HD (2500/3500) –Crew Cab	☒ 2007 - 2010	✓	✓
Sierra / Silverado HD (2500/3500) –Crew Cab	☒ 2011 - 2014	✓	✓
Sierra / Silverado HD (2500/3500) –Extended Cab	☒ 2007 - 2014	✓	✓
Sierra / Silverado Double Cab – 4 door (2 smaller)	2014 - 2018	✓	✓
Sierra / Silverado Crew Cab - 4 door	2014 - 2018	✓	✓
Sierra / Silverado Double Cab - 4 door	2019 - 2026	✓*	✓*
Sierra / Silverado Crew Cab - 4 door	2019 - 2026	✓*	✓*
Sierra / Silverado HD (2500/3500) – All models	2015 - 2019	✓	✓
Sierra / Silverado HD (2500/3500) – All models	2020 - 2027	✓*	✓*
Terrain / Equinox	2018 - 2024	✓*	✓*
Terrain / Equinox	2025 - 2027	✓*	✓*
Traverse / Enclave	2018 - 2024	✓	✓
HONDA		DRIVER	FRONT PASSENGER
Odyssey	☒ 2005 - 2010 ★	✓	✓
Odyssey	☒ 2011 - 2017	✓	✓
Odyssey	2018 - 2027	✓	✓
HYUNDAI		DRIVER	FRONT PASSENGER
Palisade	2020 - 2025	✓*	✓*

☒ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

☒ Transfer height depends on models and equipment, validate with our team before ordering.

ADAPT SOLUTIONS

BACK

09-2026

XL SEAT/ASENTO QUICK REFERENCE

page 3 of 4

KIA			DRIVER	FRONT PASSENGER
EV9		2024 - 2027	✓	✓
Sedona		2015 - 2021	✓	✓
Carnival		2022 - 2027	✓*	✓
Telluride		2020 - 2025	✓*	✓*
MERCEDES			DRIVER	FRONT PASSENGER
Metris		2016 - 2023	✓	✓
NISSAN			DRIVER	FRONT PASSENGER
Ariya		2022 - 2026	✓	✓
SUBARU			DRIVER	FRONT PASSENGER
Forester		2014 - 2018	✓	✓
TESLA			DRIVER	FRONT PASSENGER
X		2015 - 2020	✓	✓
X		2021 - 2026	✓	✓
TOYOTA			DRIVER	FRONT PASSENGER
4 Runner		2010 - 2024	✓	✓
Highlander		⚡ 2014 - 2019	✓	✓
Rav 4		⚡ 2006 - 2012	✓	✓
Rav 4		⚡ 2013 - 2018	✓*	✓*
Rav 4		2019 - 2025	✓	✓
Sienna		⚡ 2004 - 2010 ★	✓	✓
Sienna		⚡ 2011 - 2020 ★	✓	✓
Sienna		2021 - 2027	✓	✓
Tacoma Access Cab - Suicide door		2005 - 2015	✓	✓
Tacoma Double Cab - 4 reg. door		2005 - 2015	✓	✓
Tacoma Double Cab - 4 reg. door		2016 - 2023	✓	✓
Tacoma Access Cab - Suicide door		2016 - 2023	✓	✓
Tundra Double Cab - 4 door (2 smaller)		2014 - 2021	✓	✓
Tundra Crew Max - 4 door		2014 - 2021	✓	✓
VOLKSWAGEN			DRIVER	FRONT PASSENGER
Routan		⚡ 2009 - 2012 ★	✓	✓
Atlas		2018 - 2026	✓	✓
ID Buzz		2025 - 2027	✓	✓
Notes to specific applications marked * on the XL-SEAT/ASENTO QUICK REFERENCE				
ASENTO	Ram 2500 / 3500	2019-2027	NOT AVAILABLE - Space and transfer height not compatible.	
XL-SEAT	Jeep Wrangler- 4 Door	2007-2018	NOT AVAILABLE for JL model (2018)	
ASENTO	F-150 Super Cab	2009-2014	NOT AVAILABLE for model with ONLY 2 DOORS	
ASENTO	F-150 Super Cab	2009-2014	NOT AVAILABLE for model with ONLY 2 DOORS	
ASENTO	Ranger Super Cab	2019-2023	NOT AVAILABLE	
ASENTO	Expedition	2018-2024	NOT AVAILABLE for model with MANUAL SEAT	
ASENTO	Explorer	2020-2027	NOT AVAILABLE for model with MANUAL SEAT	
ASENTO	Blazer	2019-2026	NOT AVAILABLE for ELECTRIC MODEL (Blazer EV)	
ASENTO	Sierra\ Silverado	2019-2027	NOT AVAILABLE for ELECTRIC MODEL	
ASENTO	Terrain\ Equinox	2018-2024	NOT AVAILABLE for ELECTRIC MODEL	
ASENTO	Terrain\ Equinox	2025-2027	NOT AVAILABLE for ELECTRIC MODEL	
ASENTO	Palisade	2020-2025	NOT AVAILABLE for model with MANUAL SEAT	

⚡ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

☞ Transfer height depends on models and equipment, validate with our team before ordering.

ADAPT SOLUTIONS
BACK
09-2026

XL SEAT/ASENTO QUICK REFERENCE

page 4 of 4

ASENTO	Telluride	2020-2025	NOT AVAILABLE for model with MANUAL SEAT
ASENTO	Navigator	2018-2024	NOT AVAILABLE for model with PERFECT POSITION SEAT
ASENTO	Carnival	2022-2027	NOT AVAILABLE for model with MANUAL SEAT (Driver)
XL-SEAT	Rav 4	2013-2018	NOT AVAILABLE for model with POWER SEATS
★ = HI-LIFT available with XL-SEAT. HI-LIFT NOT AVAILABLE with ASENTO			



2021-2027	Grand Caravan	
EV-CHR17		“Height: 21" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		Seatbelt pre-tensioner must be relocated.
2017-2027	Pacifica	
EV-CHR17		“Height: 21" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		Seatbelt pre-tensioner must be relocated.
Compatible with HYBRID model.		
2020-2027	Voyager	
EV-CHR17		“Height: 21" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		Seatbelt pre-tensioner must be relocated.
2019-2027	Ram 1500 Crew Cab – 4 door	
EV-RAMQ19		“Height: 24" / Average install: 3-5 hrs
Doorsill shrouds must be cut STENCIL PROVIDED.		Lower B pillar shroud replaced PROVIDED.
➔ Please specify if POWER SEATS additional parts supplied. Buttons relocated to front of seat.		PASSENGER SIDE ONLY: Jack kit assembly must be relocated.
➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL		
2019-2027	Ram 1500 Quad Cab – 4 door	
EV-RAMQ19		“Height: 24" / Average install: 3-5 hrs
Doorsill shrouds must be cut STENCIL PROVIDED.		Lower B pillar shroud replaced PROVIDED.
➔ Please specify if POWER SEATS additional parts supplied. Buttons relocated to front of seat.		PASSENGER SIDE ONLY: Jack kit assembly must be relocated.
➔ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL		



2015-2024	Edge	
EV-EDG15		“Height: 22½ " / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		
2018-2024	Expedition / Navigator	
EV-EXP18		“Height: 25.75" / Average install: 3-5 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED		OEM Seat trim must be modified
NOT AVAILABLE for model with MANUAL SEAT.		Power seat buttons relocated to the front of the seat
NOT AVAILABLE for model with PERFECT POSITION SEAT (Navigator).		
2020-2027	Explorer	
EV-EXL20		“Height: 22" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED		NOT AVAILABLE FOR MODEL WITH MANUAL SEAT.
2017-2027	Raptor Super Crew Cab - 4 door	
EV-F150C18		“Height: 28" / Average install: 2-4 hrs
Upper B-pillar shroud modified.		Lower B-pillar shroud must be modified. STENCIL PROVIDED
2018-2027	F-150 Super Crew Cab – 4 door	
EV-F150C18		“Height: 26" / Average install: 2-4 hrs
Upper B-pillar shroud modified.		Lower B-pillar shroud must be modified. STENCIL PROVIDED
2017-2027	F-250, F-350, F-450 Super Crew Cab – 4 door	
EV-F150C18		“Height: 28" / Average install: 2-4 hrs
Upper B-pillar shroud modified.		Lower B-pillar shroud must be modified. STENCIL PROVIDED
2016-2023	Lincoln MKX / Nautilus	
EV-EDG15		“Height: 22½ " / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		

2019-2023	Ranger Super Crew Cab	
EV-RNG19		“Height: 25” / Average install: 3-5 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED		OEM seat trim must be modified. STENCIL PROVIDED
2024-2027	Ranger Super Crew Cab	
EV-RNG24		“Height: 25 ¾” / Average install: 2-4 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED		



2017-2023	Acadia	
EV-ACA17		“Height: 21” / Average install: 2-4 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. If equipped with manual seats, recline handle is replaced PROVIDED		⤵ Please specify if POWER SEATS additional parts supplied.
2019-2026	Blazer	
EV-BLZ19		“Height: 21"-23" / Average install: 2-4 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. If equipped with manual seats, recline handle is replaced PROVIDED		⤵ Please specify if POWER SEATS additional parts supplied. NOT AVAILABLE FOR ELECTRIC MODEL EV
2015-2022	Canyon / Colorado Extended Cab - Suicide door	
EV-COLX15		“Height: 25” / Average install: 3-5 hrs
Seat shroud must be modified PARTS SUPPLIED.		
2015-2022	Canyon / Colorado Crew Cab - 4 door	
EV-COLC15		“Height: 24.5” / Average install: 3-5 hrs
Seat shroud must be modified PARTS SUPPLIED.		Lower B-pillar shroud must be modified.
2023-2027	Canyon / Colorado Crew Cab - 4 door	
EV-COLC23		“Height: 25.5” / Average install: 3-5 hrs
Seat shroud must be modified / STENCIL PROVIDED.		Lower B-pillar shroud must be modified / STENCIL PROVIDED.
2014-2018	Sierra / Silverado Double Cab - 4 door (2 smaller)	
EV-SILC14		“Height: 24" (4x4) / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		Seat shroud must be modified PARTS SUPPLIED.
2014-2018	Sierra / Silverado Crew Cab - 4 door	
EV-SILC14		“Height: 24" (4x4) / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		Seat shroud must be modified PARTS SUPPLIED.
2019-2026	Sierra / Silverado Double Cab - 4 door	
EV-SILC19		“Height: 24.5" (4x4) / Average install: 3-5 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. ⤵ Please specify if LD / Limited or New Body Style (If older style, Vented seat base fan removed from seat) if POWER SEATS additional parts supplied. Buttons relocated to front of seat		NOT AVAILABLE FOR ELECTRIC MODEL EV
2019-2026	Sierra / Silverado Crew Cab - 4 door	
EV-SILC19		*Height: 24.5" (4x4) / Average install: 3-5 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. Specify LD / Limited or New Body Style (If older style, Vented seat base fan removed from seat) if POWER SEATS additional parts supplied. Buttons relocated to front of seat.		NOT AVAILABLE FOR ELECTRIC MODEL EV
2015-2019	Sierra / Silverado HD (2500/3500) – All models (Double or Crew Cab)	
EV-SILC14		“Height: 25 & 24" (4X4) / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.		• 2500 model is one inch higher off the ground than the 3500 model.
2020-2027	Sierra / Silverado HD (2500/3500) – All models (Double or Crew Cab)	
EV-SILC19		“Height: 24.5 / Average install: 2-4 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. NOT AVAILABLE FOR ELECTRIC MODEL EV		Transfer height may vary with tires, wheels and suspension. ⤵ Please specify if POWER SEATS additional parts supplied. Buttons relocated to front of seat.

2015-2020	Escalade / Suburban / Tahoe / Yukon - All models
EV-SILC14	«Height: 24.5" (4x4) / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.	
2021-2027	Escalade / Suburban / Tahoe / Yukon - All models
EV-SILC19	«Height: 24.5" (4x4) / Average install: 3-5 hrs
Lower B pillar shroud must be cut STENCIL PROVIDED. ➔ Please specify if POWER SEATS additional parts supplied. Buttons relocated to front of seat.	
2018-2024	Terrain / Equinox
EV-TER18	«Height: 21" / Average install: 3-5 hrs
Lower B-pillar shroud must be modified.	
➔ Please specify if POWER SEAT.	
NOT AVAILABLE FOR ELECTRIC MODEL EV	
2025-2027	Terrain / Equinox
EV-TER25	«Height: 22 1/4" / Average install: 3-5 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED	
2018-2024	Traverse / Enclave
EV-TRV18	«Height: 21" / Average install: 3-5 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED	



2018-2027	Odyssey
EV-HDA18	«Height: 21" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified.	



2020-2025	Palisade
EV-PAL20	«Height: 20 7/8" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED.	
NOT AVAILABLE for model with MANUAL SEAT	



2024-2027 ⚠	EV9
EV-EV924	«Height: 22-1/2" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED.	

2022-2027	Carnival
EV-KIA22	«Height: 21" / Average install: 4-6 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED.	
OEM seat controls wire must be cut and extended	
Compatible with HYBRID model.	
NOT AVAILABLE for model with MANUAL SEAT (Driver).	

2020-2025	Telluride
EV-PAL20	«Height: 20 7/8" / Average install: 2-4 hrs
Lower B-pillar shroud must be modified. STENCIL PROVIDED.	
NOT AVAILABLE for model with MANUAL SEAT+	

**2016-2023 Metris****EV-MET16**

Lower B-pillar shroud must be modified.

«Height: 22" / Average install: 2-4 hrs**2022-2026 ⚠ Ariya****EV-ARY22**Lower B-pillar shroud must be modified. | STENCIL PROVIDED
➔ Please specify if equipped with power seats.**«Height: 21" / Average install: 2-4 hrs**

MANUAL SEAT model: seat handle must be replaced | provided

**2014-2018 ⚠ Forester****EV-FOR14**

Lower B-pillar shroud must be modified.

«Height: 20.5" / Average install: 2-4 hrs**2015-2020 Tesla X****EV-TESX15**Lower B-pillar shroud must be modified - STENCIL PROVIDED
(Black trims will be supplied for all interiors)**«Height: 19" / Average install: 2-4 hrs****2021-2026 Tesla X****EV-TESX21**

Lower B-pillar shroud must be modified - STENCIL PROVIDED

«Height: 19" / Average install: 2-4 hrs

➔ Please specify for 2021 only -> 2020 Model or 2021 Redesigned Model

**2021-2027 Sienna****EV-TOY21**MANUAL SEAT model: seat handle must be replaced | provided
(Black trims will be supplied for all interiors)

⚡ Please specify if SEAT is equipped with LUMBAR SUPPORT.

⚡ Please specify if POWERED SEATS. OEM seat trim must be modified - STENCIL NOT PROVIDED FOR RIGHT - Parts supplied. Buttons relocated to front of seat.

⚡Height: 20 3/4" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified.

Limited legroom and headroom due to door dimensions.

2016-2023 Tacoma Access Cab - Suicide door**EV-TACA16**

Modification of the doorsill moulding required.

⚡Height: 24.5" / Average install: 2-4 hrs

2014-2021 Tundra Double Cab - 4 door (2 smaller)**EV-TUN14**

Lower B-pillar shroud must be modified.

⚡Height: 25.5" / Average install: 2-4 hrs

2014-2021 Tundra Crew Max - 4 door**EV-TUN14**

Lower B-pillar shroud must be modified.

⚡Height: 25.5" / Average install: 2-4 hrs

2019-2025 Rav 4**EV-RAV19**

Seat handles must be replaced | PROVIDED.

⚡ Please specify if POWER SEATS | additional parts supplied. Shroud must be modified. Buttons relocated to front of seat.

⚡Height: 23" / Average install: 3-5 hrs

Compatible with HYBRID model.

2014-2019 Highlander**EV-HLD14**

Lower B-pillar shroud must be modified.

⚡Height: 22" / Average install: 2-4 hrs

Compatible with HYBRID model.

**Volkswagen****2018-2026 Atlas****EV-ATL18**

Door sill trim panel must be modified. | STENCIL PROVIDED.

⚡Height: 21"3/8 / Average install: 4-6 hrs

Lower B-pillar shroud must be modified. | STENCIL PROVIDED.

2025-2027 ID Buzz**EV-BUZ25**

⚡Height: 23" / Average install: 4-6 hrs

Lower B-pillar shroud must be modified. | STENCIL PROVIDED.


★ = Available with **HI-LIFT**

2008-2020 Caravan / Town & Country (**discontinued 2016)	
XLS-CHRG08 ★ Available with HI-LIFT Removal or modification of doorsill moulding required. If power seat, controls may need to be relocated.	“Height: 18" / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided. ☞ Please specify if equipped with power seats.
2003-2009 ☒ Ram Reg Cab - 2 door (1500, 2500, 3500)	
XLS-RAMR02 If power seat, controls may need to be relocated. The seatbelt anchor must be connected to our equipment. OEM Map pocket may need to be removed or modified on some models	“Height: 27" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided.
2003-2009 ☒ Ram Quad Cab- 4 door (1500, 2500, 3500)	
XLS-RAMQ02 Lower B-pillar trim to be replaced by one provided for driver side. The OEM B-pillar trim and shrouds need to be trimmed for passenger side. The seatbelt retractor must be relocated to our equipment.	“Height: 27" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided. OEM Map pocket may need to be removed or modified on some models
2009-2024 Ram 1500 Quad Cab CLASSIC- 4 door	
XLS-RAMQ09 Tight application. Trims may get scratched. If power seat, controls may need to be relocated. Seat reclining handles will have to be replaced with those provided.	“Height: 27" (4X4) / Average install: 2-4 hrs Lower B-pillar trim to be replaced by one provided. Removal or modification of doorsill moulding required.
2009-2024 Ram 1500 Crew Cab - 4 door	
XLS-RAMQ09 Lower B-pillar trim to be replaced by one provided. If power seat, controls may need to be relocated. Tight application. Trims may get scratched.	“Height: 27" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided. Removal or modification of doorsill moulding required.
2006-2009 ☒ Ram Mega Cab - 4 big doors (1500, 2500, 3500)	
XLS-RAMQ02 Lower B-pillar trim to be replaced by one provided for driver side. The OEM B-pillar trim and shrouds need to be trimmed for passenger side. Seat reclining handles will have to be replaced with those provided.	“Height: 27" (4X4) / Average install: 2-4 hrs The seatbelt retractor must be relocated to our equipment. OEM Map pocket may need to be removed or modified on some models
2010-2018 Ram 2500/3500 Crew/Mega Cab - 4 doors	
XLS-RAMQ09 Lower B-pillar trim to be replaced by one provided. If power seat, controls may need to be relocated. Tight application. Trims may get scratched.	“Height: 27" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided. Removal or modification of doorsill moulding required.
2007-2018 Jeep Wrangler - 4 door	
XLS-WRG07 Lower B-pillar trim to be replaced by one provided. NOT AVAILABLE for JL model (2018)	“Height: 27.5" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided.


★ = Available with **HI-LIFT**

2006-2008 ☒	Mark LT - 4 door	
XLS-F150C04	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
Removal or modification of doorsill moulding required. If power seat, controls may need to be relocated.		
2004-2008 ☒	F-150 Reg Cab - 2 door	
XLS-F150S04	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
Removal or modification of doorsill moulding required. If power seat, controls may need to be relocated.		
2009-2010 ☒	F-150 Reg Cab - 2 door, small suicide door	
XLS-F150C09	“Height: 24.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. If power seat, controls may need to be relocated.		
2004-2008 ☒	F-150 Super Cab - Suicide door	
XLS-F150S04	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
Removal or modification of doorsill moulding required. If power seat, controls may need to be relocated.		
2009-2014 ☒	F-150 Super Cab - Suicide door	
XLS-F150S09	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. Removal or modification of doorsill moulding required.		
2015-2027	F-150 Super Cab - Suicide door	
XLS-F150S15	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
2011-2016 ☒	Raptor Super Cab - Suicide door	
XLS-F150S09	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. Removal or modification of doorsill moulding required.		
2017-2027	Raptor Super Cab - Suicide door	
XLS-F150S15	“Height: 27.5” (4X4) / Average install: 2-4 hrs	
Interior door panel must be modified STENCIL & REPLACEMENT CUTOUT PROVIDED		
2004-2008 ☒	F-150 Super Crew Cab - 4 door	
XLS-F150C04	“Height: 26.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. If power seat, controls may need to be relocated.		
2009-2014 ☒	F-150 Super Crew Cab - 4 door	
XLS-F150C09	“Height: 25.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. The seat belt detonator must be relocated to the floor adaptor.		
2015-2017	F-150 Super Crew Cab - 4 door	
XLS-F150C15	“Height: 24.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar shroud will need to be trimmed STENCIL PROVIDED. If power seat, controls may need to be relocated.		
2011-2016 ☒	Raptor Super Crew Cab - 4 door	
XLS-F150C09	“Height: 25.5” (4X4) / Average install: 2-4 hrs	
The OEM B-pillar trim will need to be trimmed. The seat belt detonator must be relocated to the floor adaptor.		
2008-2016 ☒	F-250, F-350, F-450 Super Cab - Suicide door	
XLS-F250S08	“Height: 27” (4X4) / Average install: 2-4 hrs	
Tight application. Trims may get scratched. If power seat, controls may need to be relocated.		
2008-2016 ☒	F-250, F-350, F-450 Crew Cab - 4 door	
XLS-F250C08	“Height: 27” (4X4)	
Tight application. Trims may get scratched. If power seat, controls may need to be relocated. This installation requires bolting to the rocker panel.		
2017-2027	F-250, F-350, F-450 Super Cab - Suicide door	
XLS-F150S15	“Height: 27” (4X4) / Average install: 2-4 hrs	
Interior door panel must be modified, STENCIL & CUTOUT PROVIDED 2017 Ford F-250 & F-350 4X4 model sit 1" lower than the 2017 F-150.		

☒ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

☒ Transfer height depends on models and equipment, validate with our team before ordering.

ADAPT SOLUTIONS
BACK

09-2026

★ = Available with **HI-LIFT**

2011-2014	Edge	
XLS-EDG11		“Height: 21”
Seat reclining handles will have to be replaced with those provided.		The OEM B-pillar trim will need to be trimmed.
2011-2019	Explorer	
XLS-EXL11		“Height: 23.5”
The OEM B-pillar trim will need to be trimmed.		Tight application. Trims may get scratched.
2010-2013 ⚠	Transit Connect	
XLS-FTC10		“Height: 26.5” / Average install: 2-4 hrs
The OEM B-pillar trim will need to be trimmed.		Removal or modification of doorsill moulding required.


★ = Available with **HI-LIFT**

2007-2010 ⚠	Avalanche	
XLS-SILC07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		
2011-2013 ⚠	Avalanche	
XLS-SILC11		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
If power seat, controls may need to be relocated.		Lower B-pillar trim to be replaced by one provided.
2004-2012 ⚠	Canyon / Colorado Extended Cab - Suicide door	
XLS-COLX04		“Height: 21" (2X4) / Average install: 2-4 hrs
Seat reclining handles will have to be replaced with those provided.		Removal or modification of doorsill moulding required.
1999-2006 ⚠	Sierra / Silverado Regular Cab - 2 door	
XLS-SILR99		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		If power seat, controls may need to be relocated.
OEM Map pocket may need to be removed or modified on some models		
1999-2002 ⚠	Sierra / Silverado Extended Cab - Without suicide door	
XLS-SILR99		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
This installation requires bolting to the rocker panel.		Removal or modification of doorsill moulding required.
If power seat, controls may need to be relocated.		The OEM B-pillar trim will need to be trimmed.
OEM Map pocket may need to be removed or modified on some models		
1999-2006 ⚠	Sierra / Silverado Extended Cab - Suicide door	
XLS-SILX03		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Seat reclining handles will have to be replaced with those provided.		• Transfer height may vary with tires, wheels and suspension.
If power seat, controls may need to be relocated.		Removal or modification of doorsill moulding required.
This installation requires bolting to the rocker panel.		The OEM map pocket may need to be removed.
OEM Map pocket may need to be removed or modified on some models		
2007-2013 ⚠	Sierra / Silverado Extended Cab - Suicide door	
XLS-SILX07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
The seatbelt retractor must be relocated to our equipment.		Removal or modification of doorsill moulding required.
OEM Map pocket may need to be removed or modified on some models		
2007-2010 ⚠	Sierra / Silverado Crew Cab - 4 door	
XLS-SILC07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		OEM Map pocket may need to be removed or modified on some models
2011-2013 ⚠	Sierra / Silverado Crew Cab - 4 door	
XLS-SILC11		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
If power seat, controls may need to be relocated.		Lower B-pillar trim to be replaced by one provided.
OEM Map pocket may need to be removed or modified on some models		
2007-2014 ⚠	Sierra / Silverado HD (2500/3500) – Extended Cab – Suicide door	
XLS-SILX07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		OEM Map pocket may need to be removed or modified on some models
2007-2010 ⚠	Sierra / Silverado HD (2500/3500) – Crew Cab - 4 door	
XLS-SILC07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		OEM Map pocket may need to be removed or modified on some models
2011-2014 ⚠	Sierra / Silverado HD (2500/3500) – Crew Cab - 4 door	
XLS-SILC11		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
If power seat, controls may need to be relocated.		Lower B-pillar trim to be replaced by one provided.
OEM Map pocket may need to be removed or modified on some models		
2007-2010 ⚠	Escalade / Suburban / Tahoe / Yukon - All models	
XLS-SILC07		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		OEM Map pocket may need to be removed or modified on some models
2011-2014 ⚠	Escalade / Suburban / Tahoe / Yukon - All models	
XLS-SILC11		“Height: 24"-25" (4X4) / Average install: 2-4 hrs
If power seat, controls may need to be relocated.		Lower B-pillar trim to be replaced by one provided.
OEM Map pocket may need to be removed or modified on some models		

⚠ LEGACY: Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.

“Transfer height depends on models and equipment, validate with our team before ordering.

ADAPT SOLUTIONS
BACK

09-2026



2005-2010	Odyssey	
XLS-HDA05 ★ Available with HI-LIFT		“Height: 18” / Average install: 2-4 hrs
Tight application. Trims may get scratched. The seatbelt anchor must be connected to our equipment.		If power seat, controls may need to be relocated.
2011-2017	Odyssey	
XLS-HDA11		“Height: 21” / Average install: 2-4 hrs
Tight application. Trims may get scratched. The OEM B-pillar trim will need to be trimmed.		If power seat, controls may need to be relocated.



2015-2021	Sedona	
XLS-KIA16		“Height: 20.5” / Average install: 2-4 hrs
Lower B pillar shroud needs to be cut STENCIL PROVIDED.		Seat shroud must be cut STENCIL & MODIFIED TRIM PROVIDED



2004-2010	Sienna	
XLS-TOY04 ★ Available with HI-LIFT		“Height: 18” / Average install: 2-4 hrs
If power seat, controls may need to be relocated.		
2011-2020	Sienna	
XLS-TOY11 ★ Available with HI-LIFT		“Height: 22” / Average install: 2-4 hrs
Tight application. Trims may get scratched.		If power seat, controls may need to be relocated.
2005-2015	Tacoma Access Cab - Suicide door	
XLS-TACA05		“Height: 24.5” (4X4) / Average install: 2-4 hrs
2005-2015	Tacoma Double Cab – 4 reg. door	
XLS-TACD05		“Height: 24.5” (4X4) / Average install: 2-4 hrs
The OEM B-pillar trim will need to be trimmed.		Removal or modification of doorsill moulding required.
2016-2023	Tacoma Double Cab – 4 reg. door	
XLS-TACD16		“Height: 25.5” (4X4) / Average install: 2-4 hrs
The OEM B-pillar trim removed and replaced PROVIDED		
2010-2024	4 Runner	
XLS-T4R10		“Height: 25.5” (4X4) / Average install: 2-4 hrs
Tight application. Trims may get scratched.		The OEM B-pillar trim will need to be trimmed.
2006-2012	RAV 4	
XLS-RAV06		“Height: 21.5” / Average install: 2-4 hrs
Seat reclining handles will have to be replaced with those provided.		If power seat, controls may need to be relocated.
2013-2018	RAV 4	
XLS-RAV13		“Height: 21” / Average install: 2-4 hrs
Tight application. Trims may get scratched. Seat reclining handles will have to be replaced with those provided.		NOT AVAILABLE if equipped with power seats





Volkswagen

★ = Available with **HI-LIFT**

2009-2012 ⚠ **Routan**

XLS-CHRG08 ★ Available with HI-LIFT

Seat reclining handles will have to be replaced with those provided.

If power seat, controls may need to be relocated.

⏏Height: 18" / Average install: 2-4 hrs

Removal or modification of doorsill moulding required.

SPEEDY-LIFT



FIND A DEALER

Looking for a dealer near you or a client, use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEO

Overview of the ASENTO & SPEEDY-LIFT in motion with music.



HIGHLIGHTS:

- Fast moving complete with automatic locking mechanism.
- Takes up very little space; in most applications only one seat is removed.
- 95 lbs capacity.
- 3-year warranty.
- Adapter available for folding chairs – less than 2 lbs and easily removed.

Part # SL-WCBR-00



THINGS TO NOTE

Designed for mid-row in minivans, manual rigid or folding frame wheelchair.

SPEEDY-LIFT QUICK REFERENCE

The SPEEDY-LIFT is available in the mid-row on the driver & passenger side

CHRYSLER		
Caravan / Town & Country - Stow 'N Go		2005 - 2007
Town & Country - Swivel 'N Go		2008 - 2011
Caravan / Town & Country		☒ 2008 - 2020
Grand Caravan		* 2021 - 2027
Pacifica *		* 2017 - 2027
Voyager * (USA)		2020 - 2027
FORD		
Transit Connect		☒ 2010 - 2013
HONDA		
Odyssey		☒ 2005 - 2010
Odyssey		☒ 2011 - 2017
Odyssey		2018 - 2027
KIA		
Sedona		☒ * 2015 - 2021
Carnival		2022 - 2027
MAZDA		
Mazda 5 *Discontinued in USA in 2015, 2017 in Canada.		☒ 2006 - 2017
MERCEDES		
Metris		2016 - 2023
TESLA		
X		* 2015 - 2026
TOYOTA		
Sienna		☒ 2004 - 2010
Sienna - 7 passenger		☒ 2011 - 2020
Sienna - 8 passenger (*passenger side note: all mid-row seats will be removed)		☒ 2011 - 2020
Sienna - 7 passenger		2021 - 2027
Sienna - 8 passenger (*passenger side note: all mid-row seats will be removed)		2021 - 2027
VOLKSWAGEN		
Routan		☒ 2009 - 2012
ID Buzz		2025 - 2027
Notes to specific applications marked * on the SPEEDY-LIFT QUICK REFERENCE		
Chrysler Pacifica	2017-2027	*NOT AVAILABLE for passenger side equipped with bench seat & 8 passenger LXi model
Grand Caravan	2021-2027	*NOT AVAILABLE for passenger side equipped with bench seat & 8 passenger LXi model
Toyota Sienna	2011-2020	*NOT AVAILABLE for models with OEM footrest.
Voyager	2020-2027	*NOT AVAILABLE for passenger side equipped with bench seat & 8 passenger LXi model
Sedona	2015-2021	*NOT AVAILABLE for models with OEM footrest (Discontinued in Canada 2019-2020 model)
Tesla X	2015-2026	*NOT AVAILABLE passenger side for model with Bench seat.
Tesla X	2021-2026	*NOT AVAILABLE for model with Bucket Seat.
☒ Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.		



2005-2007	Caravan / Town & Country – Stow 'N Go	
SP-CHRG05	*Average install: 1.5-2.5 hours	The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed.
2008-2011	Town & Country – Swivel 'N Go	
SP-CHRG05	*Average install: 1.5-2.5 hours	
2008-2020	Grand Caravan / Town & Country	
SP-CHRG05	*Average install: 1.5-2.5 hours	The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed.
2021-2027	Grand Caravan	
SP-CHR17	*Average install: 1.5-2.5 hours	NOT AVAILABLE for PASSENGER side equipped with bench seat.
⌚ Please specify 2 nd Row Seating: Bench or Stow 'N Go		NOT AVAILABLE for 8 passenger LXi model.
⌚ Please specify if it is hybrid.		Stow n Go seat stays in the floor.
⌚ Please specify driver or passenger side application - Left or Right.		In the 8 passenger model, the jump seat must be removed.
2017-2027	Chrysler Pacifica	
SP-CHR17	*Average install: 1.5-2.5 hours	NOT AVAILABLE for PASSENGER side equipped with bench seat.
⌚ Please specify 2 nd Row Seating: Bench or Stow 'N Go		NOT AVAILABLE for 8 passenger LXi model.
⌚ Please specify if it is hybrid.		Stow n Go seat stays in the floor.
⌚ Please specify driver or passenger side application - Left or Right.		In the 8 passenger model, the jump seat must be removed.
2020-2027	Voyager (USA)	
SP-CHR17	*Average install: 1.5-2.5 hours	NOT AVAILABLE for PASSENGER side equipped with bench seat.
⌚ Please specify 2 nd Row Seating: Bench or Stow 'N Go		NOT AVAILABLE for 8 passenger LXi model.
⌚ Please specify if it is hybrid.		Stow n Go seat stays in the floor.
⌚ Please specify driver or passenger side application - Left or Right.		In the 8 passenger model, the jump seat must be removed.



2010-2013 ⌚	Transit Connect	
SP-FTC10L	*Average install: 1.5-2.5 hours	⌚ Please specify driver or passenger side application - Left or Right.



2005-2010 ⌚	Odyssey	
SP-HDA05	*Average install: 1.5-2.5 hours	⌚ Please specify driver or passenger side application - Left or Right.
2011-2017 ⌚	Odyssey	
SP-HDA11	*Average install: 1.5-2.5 hours	In the 8-passenger model, the jump seat must be removed.
2018-2027	Odyssey	
SP-HDA18	*Average install: 1.5-2.5 hours	In the 8-passenger model, the jump seat must be removed.



2015-2021 ⌚	Sedona	
SP-KIA16	*Average install: 1.5-2.5 hours	NOT AVAILABLE for models with OEM footrest . <i>Discontinued in Canada 2019-2020 model.</i>
2022-2027	Carnival	
SP-KIA22	*Average install: 1.5-2.5 hours	⌚ Please specify if equipped with OEM footrest VIP Lounge Seats model SX


2006-2017 ⌚

Mazda 5
SP-MZD506
***Average install: 1.5-2.5 hours** **Mazda 5 discontinued in USA in 2015; 2017 in Canada.*

2016-2023
Metris
SP-MET16
***Average install: 1.5-2.5 hours** ALL MIDROW SEATS MUST BE REMOVED

2015-2026
Tesla X
SP-TESX15
***Average install: 4 - 5 hours**

 ➡ Please specify 2nd Row Seating: Bench or Bucket

NOT AVAILABLE PASSENGER side model with bench seat.

NOT AVAILABLE for BUCKET SEAT model 2021+

ALL MIDROW SEATS MUST BE REMOVED


2004-2010 ⌚

Sienna
SP-TOY04
2011-2020 ⌚

Sienna | 7 or 8 passenger minivans
SP-TOY11
***Average install: 1.5-2.5 hours** In the right or passenger side of the 8-passenger minivan,
ALL MIDROW SEATS MUST BE REMOVED

2021-2027
Sienna | 7 or 8 passenger minivans
SP-TOY21
***Average install: 1.5-2.5 hours** In the right or passenger side of the 8-passenger minivan,
ALL MIDROW SEATS MUST BE REMOVED

Volkswagen
2009-2012 ⌚

Routan
SP-CHRG05
***Average install: 1.5-2.5 hours**

 The OEM seat will remain trapped in the floor if a **SPEEDY-LIFT** is installed.

2025-2027
ID BUZZ
SP-BUZZ25
***Average install: 1.5-2.5 hours**

 The OEM seat will remain trapped in the floor if a **SPEEDY-LIFT** is installed.

HI-LIFT



FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEO

Overview of the XL-SEAT & HI-LIFT in motion.



HIGHLIGHTS:

- Very compact and easy to use.
- Manual track allows for additional space inside the vehicle. Seat can be used in vehicle if chair is not being transported.
- Makes a great pair with the XL-SEAT.
- 75 lbs capacity.
- 3 year warranty.



THINGS TO NOTE

Only available in limited minivan applications. See list on next page. Ideally for rigid frame chairs. Folding chairs are not likely to fit 'height wise' in the door opening and therefore would be stowed not folded.

HI-LIFT QUICK REFERENCE

CHRYSLER		DRIVER	FRONT PASSENGER
Caravan / Grand Caravan / Town & Country	★ 1991 - 2007 ⚠	✓	✓
Caravan / Grand Caravan / Town & Country	★ 2005 - 2007 ⚠	✓	
Caravan / Grand Caravan / Town & Country	★ 2008 - 2020 ⚠	✓	✓
Voyager - Short & Long wheelbase	★ 1991 - 2003	✓	✓
FORD		DRIVER	FRONT PASSENGER
Freestar / Monterey	★ 2004 - 2007 ⚠	✓	✓
Windstar	★ 1999 - 2003 ⚠	✓	✓
GENERAL MOTORS		DRIVER	FRONT PASSENGER
Montana/Silhouette/Transport	★ 1997 - 2004 ⚠	✓	✓
Terreza/Uplander/Relay/Venture	★ 1997 - 2004 ⚠	✓	✓
Montana/Silhouette/Transport	★ 2005 - 2009 ⚠	✓	✓
Terreza/Uplander/Relay/Venture	★ 2005 - 2009 ⚠	✓	✓
HONDA		DRIVER	FRONT PASSENGER
Odyssey	★ 1999 - 2004 ⚠	✓	✓
Odyssey	★ 2005 - 2010 ⚠	✓	✓
KIA		DRIVER	FRONT PASSENGER
Sedona	★ 2006 - 2012 ⚠	✓	✓
NISSAN		DRIVER	FRONT PASSENGER
Quest	★ 2011 - 2016 ⚠	✓	✓
TOYOTA		DRIVER	FRONT PASSENGER
Sienna	★ 2004 - 2010 ⚠	✓	✓
Sienna	★ 2011 - 2020 ⚠	✓	✓
VOLKSWAGEN		DRIVER	FRONT PASSENGER
Routan	★ 2009 - 2012	✓	✓
⚠ Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated price and lead time.			

XL-BOARD



FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



PRODUCT VIDEO

Overview of the XL-BOARD & SPEEDY-LIFT in motion.



HIGHLIGHTS:

- 275 lbs capacity. Static board, no motor. Easy to use; folds up and out of the way.
- Ideal vehicle for those that want a sedan with space for their wheelchair. Works great when paired with the SPEEDY-LIFT.
- Keep up to 5 seats – depending on the size of the wheelchair.



THINGS TO NOTE

This product is only available for the MAZDA 5. No other vehicles. Mazda 5 discontinued in 2015 in USA and 2017 in Canada.



XL-BOARD QUICK REFERENCE

MAZDA		
Mazda 5 *	2006 - 2017	XLB-MZD506

*Mazda 5 discontinued in USA in 2015; 2017 in Canada.

POWER-PULL



FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEOS

Overview of the POWER-PULL in a side entry and rear entry lowered floor minivan, in motion.



HIGHLIGHTS:

- Available in two models, one designed specifically for side entry and one designed specifically for rear entry.
- Does not take up space on the floor. Allows easy maneuvering.
- Multiple safety features and wireless pendant.
- Release feature allows easier positioning.
- 350 lbs capacity. 15 feet of strong, stainless steel cable.
- 3 year warranty.



THINGS TO NOTE

Requires user to hook onto their wheelchair. Button must be depressed to make unit move.



POWER-PULL QUICK REFERENCE

LOWERED FLOOR MINIVAN

SIDE ENTRY

PP000-01

REAR ENTRY

PR000-01